



# **BMD PLUG GAUGES**

# www.diatest.com

#### Page

- 3 DIATEST Expertise for precision and safety
- 4 Technical description
- 9 Basic plug gauge types
- 10 Basic type Standard
- 11 Basic type for through bores
- 12 Basic type for blind bores
- 13 Basic types with compressed air supply
- 14 Plug gauges for automatic gauging
- 15 Special-purpose plug gauges
- 21 PA for measuring parallel wall gaps
- 22 Multiplane plug gauges
- 24 Indicator holders
- 27 Indicator holders with adjustable spring pressure
- 29 Electrical probe holders
- 30 Special gauge holders
- 33 Holders for Analodig indicators
- 34 Adapters
- 36 Right-angle attachments
- 37 Depth extensions
- 40 Depth stops
- 42 Small measurement fixtures
- 46 Floating holders
- 50 Spare parts
- 51 General and technical abbreviations





#### **DIATEST** manufactures high-precision bore gauging instruments and metrological solutions

High-volume engineering does not work without precision, a global production depends on local experts.

To achieve highest possible safety in production precision is necessary starting from design to final product as well as a qualified and trained local DIATEST partner speaking the national language and knowing the products.

Our clients are manufacturers all over the world demanding a high standard of accuracy and quality, for example the aviation and aerospace industry, the automobile and hydraulics industry, medical industry as well as general engineering.



Your advantage as user: regardless of industrialized country of production you can always feel safe due to DIATEST quality. Your local DIATEST partner takes care of you. Our partners not only know their country, culture, language and market, but also have experiences and know-how of DIATEST and quality control.

The name DIATEST guarantees worldwide quality, expertise and safety. Measuring instruments with an accuracy of up to 0.0002 mm / 0.000008 inch ensure an absolutely accurate result. DIATEST is DIN ISO 9001 certificated.

Future-orientated manufacturing technology (*Industrie* 4.0, *VDA volume* 5, etc...), well-trained precision engineering technicians and engineering knowledge guarantee highest quality standards. Whether standard- or customer specific solutions, DIATEST measuring instruments will be adequate for future tasks.

This is the company's philosophy, carried out by an experienced staff: Highest quality at a fair cost effectiveness, combined with expert advice and absolute faithfulness to deadlines in dealing with all DIATEST customers. For us this is a service taken for granted which our DIATEST partners worldwide appreciate. This is what partnership means to us.

DIATEST – Safety through quality, precision and competence in more than 40 countries of the world

#### ())) INDUSTRIE 4.0

WDA BAND 5 ready



#### **Technical description**

Plug gauges (BMD) are self-indicating, self-centering, high precision measurement instruments. These easy-to-use gauges are suitable for both static and dynamic measurements. They can be used for manual detection of dimensional deviations and shape defects in bores in serial measurement at the machine but may also be installed in measuring equipment and automated systems.

 $\bigcirc$ 

•**O**•

O)) INDUSTRIE**4.0** 

A broad range of applications, ease of handling, superior precision and rugged construction are combined in a highly costeffective system. A wide selection of basic types in the standard programme, supplemented by useful accesso-

supplemented by useful accessories, ensures that nearly all bores encountered in actual practice can be measured precisely.

The range of display instruments includes mechanical indicators, digital displays and sensors connected to analytical equipment. Peripheral equipment provides for static data analysis, dimension-based tool control and many other useful options.

#### **Special models**

The BMD Technical Guide is intended to assist you in selecting the most suitable measurement equipment. For special measurement problems we need a detailed description of the measurement task as well as a

drawing or sample in order to prepare an offer. An optimum offer depends on precise, complete information.

Please note: Deviations regarding technical aspects of specially designed BMD gauges as opposed to standard gauges are possible!

#### Special markings (SO-B)

#### Special markings data matrix code (SO-B-DMC) (extra charge)

We can provide special markings, such as customer-specific ID numbers, tolerances, etc. Please keep in mind that the possibilities for adding special markings to small plug gauges are limited. The surcharge for SO-B is calculated for each commenced 10 characters (see price list).

# Design and material characteristics:

Probe: spring steel, approx. 61 HRC Needles: carbide, approx. 1650 HV Guide cylinder: gauge steel or stainless steel. Special cylinder designs: OCR = steel cylinders, hardened and black finished Please note: OCR plug gauges are not suitable for rough measurement conditions. ZHML = cylinder with carbide bars, 🗊 14 ZKUL = cylinder with plastic bars, 17

#### **Technical data**

All dimensions are quoted in mm unless otherwise specified. We reserve the right to make technical modifications in order to improve performance. Minor deviations which do not impact significantly on measurement equipment performance may occur.


Information regarding technological advances and the most recent version of our documentation is also available on the Internet at www.diatest.com

#### **Zero setting**

Zero setting should be performed with the aid of a setting ring that corresponds precisely to the minimum bore size. This ensures that the risk of radial and axial errors is largely eliminated during the calibration process. The most suitable setting rings are those which comply with the specifications of DIN 2250-C. Setting rings with larger dimensions or for minimum, medium and maximum dimensions are generally not required.

#### Function

The guide cylinder (4) centers the probe gauging contacts (6) fixed to the split ball probe (5) axially and radially in the bore. The lapped cone of the needle (3) translates the distance travelled by the gauge contacts 1:1 to the indicator (1) clamped in the holder (2).

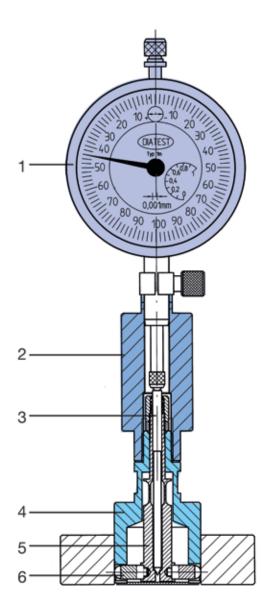





SO-ZL



#### **Production times**

Production times are quoted ex factory, as shown in the table below.

#### **Service life**

Service life depends upon such conditions as work piece surface quality (roughness, coating), material, length of measured bore, dirt accumulation, gauging pressure etc. Up to a few million measurements are possible under optimum conditions.

#### **Repair Service**

DIATEST offers a fast and costeffective repair service for standard BMD.

Service 1: Exchange of gauging unit and functional testing. Approx. 10 working days, ex works. Service 2: Exchange of gauging unit, fully re-chromed cylinder and functional testing. Approx. 15 working days, ex works. A cost estimate for special BMD plugs will be provided (on request).

#### Maintenance

No special maintenance is required. If cleaning is needed, remove the needle and clean the plug gauge and the needle carefully with compressed air and a cleaning solution.

#### **Standard production times**

Plug gauge type	working days
S, D, PK, OR, 2R, S-FB up to nom. dim. 100 mm	10
S, D, PK, OR, 2R, S-FB above nom. dim. 100 mm	15
FB, 3P, L, PK-2Z, MZ, AT0	15
SO-TA, UM, PA, SO-W10, T-BMD	25
ZHML	30

Saturdays, Sundays, public holidays and company holidays are not counted as production days and will extend delivery times accordingly.

# Express production times (extra charge) Plug gauge type working days

i lag gaago typo	Working days
S, D, PK, OR, 2R, S-FB up to nom. dim. 100 mm	5-8
S, D, PK, OR, 2R, S-FB above nom. dim. 100 mm	8-10
FB, 3P, L, PK-2Z, MZ, AT0	8-10
SO-TA, UM, PA, SO-W10, T-BMD , ZHML	15

Delivery times for all other plug gauges, including multiplane gauges, etc, will be quoted on request.

Please note: The needle taper should be greased prior to installation (e.g. Vaseline). When installing needles for Series 6 and 10, please ensure that springs are remounted (no springs in Series 4).



#### **Gauging accuracy**

Maximum allowed deviations with new plug gauges:

Measuring range transmission error (Linearity) 2-point models fe = 1% of gauging distance min. 0.001 3-point models fe = 3% of gauging distance min. 0.002

FB design fe = 2% of gauging distance min. 0.001

Measurement range extension (MB-SO) and special designs may lead to a reduced measuring accuracy.

# Axial and radial centering errors

The plug gauge guide cylinder positions the gauging contacts in the bore and ensures high repetition accuracy. Short guide paths and/or excessive clearance between the bore and the guide cylinder result in lower repeatability due to tipping and lateral shifting.

# Nominal dimensions and standard measurement ranges

Plug gauge order dimension (nominal dimension) = minimum bore dimension Example: Ø 35 D7 = Ø 35 +0.08/+0.105 BMD nom. dimension = 35.08

BMD nom. dimension = 35.08Ø 35 H7 = Ø 35 +0/+0.025 BMD nom. dimension = 35.0

#### Measuring range extension (MB-SO) (extra charge)

The standard measuring range can be extended for applications requiring measurement of larger bore tolerances. Please note: Some plug gauges with MB-SO have smaller contact point radii. This poses the danger of axial and radial errors. Please enquire before using diamond measurement contacts. ()) INDUSTRIE 4.0

A measuring range extension of e.g. MB-SO+0.4 indicates that the entire measurement range of the plug gauge is 0.4 mm, based on the nominal plug gauge dimension.

Measurements taken in horizontal direction may lead to smaller measuring ranges.

#### Measuring range, based on nominal BMD dimension

BMD series	Application range	Measuring range
4	Ø 2.98 - 9.0	+ 0.1 mm
6	Ø 7.0 - 20.0	+ 0.15 mm
10	Ø 15.0 - 270.0	+ 0.2 mm
FB6	Ø 7.0 - 16.0	+ 0.15 mm
FB10	Ø 15.0 - 150.0	+ 0.15 mm
3P (Series 6)	Ø 8.0 - 20.0	+ 0.15 mm
3P (Series 10)	Ø 15.0 – 100.0	+ 0.2 mm
T-BMD	Ø 2.25 (PA 1.0) - 2.98	+ 0.15 mm

#### Measuring range extension (MB-SO)

· · · · · · · · · · · · · · · · · · ·
max. meas. range (order suffix)
max. MB-SO + 0.15
max. MB-SO + 0.2
max. MB-SO + 0.4
max. MB-SO + 0.8
max. MB-SO + 0.6
max. MB-SO + 0.4
max. MB-SO + 0.3
max. MB-SO + 0.3
max. MB-SO + 0.3
max. MB-SO + 0.4

For option MB-SO we recommend option PG in addition ( 8).

5

# Measuring range limitation (MB-B)

For plugs series 6, 10 and FB the standard measuring range can be reduced, if requested. Order suffix: MB-B and max. desired measuring range. Sample order for max. measuring range of +0.1 mm instead of 0.2 mm:

BMD-S10-CR-35.0-MB-B+0.1 Washers can also be used to reduce the measurement range. DIATEST offers a line of washers for this purpose: BMD Series 6 US-6 BMD Series 10 US-10

Indica pressu

O)) INDUSTRIE**4.0** 

# Indicators, measuring pressure

Plug gauges can be used with nearly all mechanical and electronic indicator units with Ø 8h and 3/8" stem. Measuring pressure has a significant influence on the service life and accuracy of BMD.

Recommended measuring pressures for standard measurement ranges:

 BMD Series 4
 appro. 0.3 - 0.4 N

 BMD Series 6
 appro. 0.6 - 1.0 N

 BMD Series 10
 appro. 0.8 - 1.6 N


 Please note:

It may be necessary to increase measuring pressure when using options MB-SO and PG.

# Measuring pressure reduction

Only low gauging pressure is needed when using Series 4 BMD, to measure thin-walled objects or to reduce wear on measuring contacts. It is often impossible to obtain a suitable reading. Special indicator holders or adapters can be used to reduce the measuring pressure of the indicator. In addition, option PG provides for the possibility of lifting the gauging contacts from the bore surface.

Type PG	18
Holder MH6-73-R	1 24
Holder MH10-150-PG	1 32
Holder MH10-150-R	1 25
Holder MH10-150-F	1 30
Adapter A4-10-F	1 34
Adapter A6-6-F	1 35
MH4-67-F	1 28
MH6-65-F	1 28

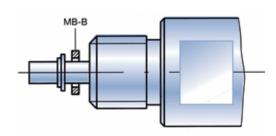

#### **Contact points**

Large contact point radii (see table MHM) are important to ensure long service life and are required when gauging bores with rough surfaces. Our BMD gauging contacts meet these requirements.

The selection of gauging contact material depends on the composition of the workpiece and the conditions affecting wear. BMD gauging contacts are available in several different materials.. If you are not sure which material is best suited for your workpiece please get in touch with us.

Carbide contact points (MHM) Plug gauges are fitted with carbide contact points (standard, no extra charge). Carbide: approx. 1850 HV Carbide should not be used for workpieces composed of nonferrous metal, aluminium or their alloys.

#### Contact points carbide (MHM)

			,			
BMD series	Diam	ete	r range	Gaug	ing radius	
Series 4	2.98	-	9.0	R =	0.5	
Series 6	7.0	-	20.0	R =	2.0	
Series 10	15.0	-	25.0	R =	2.5	
	> 25.0	-	31.0	R =	4.5	
	> 31.0	-	35.0	R =	6.5	
	> 35.0	-	41.0	R =	8.5	
	> 41.0	-	47.0	R =	10.5	
	> 47.0	-	56.0	R =	13.0	
	> 56.0	-	66.0	R =	16.0	
	> 66.0	-	120.0	R =	20.0	
	> 120.0	-	150.0	R =	25.0	
	> 150.0	-	270.0	R =	30.0	
Option MB-SO+0.4 to	0.5			R =	4.5	
Option MB-SO+0.5 an	d above			R =	2.5	
BMD-FB6	7.0	-	16.0	R =	2.0	
BMD-FB10	15.0	-	18.0	R =	1.0	
	> 18.0	-	150.0	R =	1.5	
BMD-ME		-		R =	4.5	
BMD-PK (Series 10)		-		R =	2.5	
BMD-PK (Series 6)	7.9	-	20.0	R =	2.0	
BMD-3P (Series 10)		-		R =	2.5	
BMD-3P (Series 6)	8.0	-	20.0	R =	2.0	

# 

Hard chrome contact points (MCR)

Hard chrome contacts are suitable for use with non-ferrous metals, aluminium and their alloys. These contact points are made of carbide steel coated with a hard chrome layer. The hard chrome layer is approx. 0.03 mm thick. Option MCR is not suited for applications involving heavy wear conditions or very soft workpiece materials. In these cases, it is advisable to opt for diamond gauging contacts (MDI). Contact point radii (see Table MHM) Hardness: approx. 1000 HV Order suffix: MCR Available for nominal diameters of 3,95 and above. Example: BMD-S10-CR-35.0-MCR

Ceramic contact points (MKE) (extra charge) Like option MCR, ceramic contact points are suited for use with non-ferrous metals and aluminium. When working with very soft aluminium materials, the ceramic material may discolour. This has no impact on performance or measuring accuracy, however. Hardness: Knoop 100g 18000 Grain size: 0.5 µm Contact point radii (see table MHM) Not available for series 4 and BMD-FB Order suffix: MKE Example: BMD-S10-CR-35.0-MKE





Ruby contact points (MRU) (extra charge) For non-ferrous metals, aluminium and their alloys. It may be necessary to opt for diamond contacts when working with very soft aluminium materials, etc. contact point radii, see table MHM Hardness ruby: approx. 2000 HV

Order suffix: MRU Example: BMD-S10-35.0-MRU Not available for Series 4 and FB

#### Diamond contact points (MDI) (extra charge)

Suitable for use with extremely soft aluminium materials, under heavy wear conditions (e.g. automatic measurement) and with highly polished surfaces, etc. These contact points are made of natural diamond (available for nominal diameters of 3,95 and above).

Please note: The contact point may be damaged while working with sharp-edged workpieces. Please inquire before using the MB-SO extended range option. MDI contacts not available for series FB6 and FB10.

#### **Contact points diamond (MDI)**


BMD series	Diameter range	Gauging radius
Series 4	3.95 - 9.0	R = 0.5
Series 6	7.0 - 16.0	R = 2.0
Series 10	15.0 - 270.0	R = 2.5
Order suffix	MDI	
Example	BMD-S10-CR-35.0-M	DI

The following options may be selected for applications involving heavy wear conditions:

– Air cleaning (L)	13
– PG	8 🗊
– MDI	7 🗊
– PK-ZHML	14 🗊
<ul> <li>measuring pressure</li> </ul>	

**í** 6 reduction

#### **Protective cover AD** (extra charge)

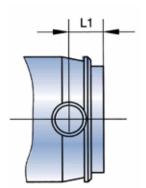

Protective covers should be used with caution. Covers protect mechanical parts and reduce the risk of dirt accumulation. However, they make it difficult to remove chips, coolants and other deposits.

Standard protective covers are made of aluminum. Covers made of steel, hardened steel and other materials are available on request. Depending on nominal diameter and design, protective covers are either glued or screwed in place.

Covers for types S and S-FB Covers for type S are available for nominal diameters of 4.0 and above. Up to a nominal diameter of 28.0. the dimension L1 increases by 0.5 mm. For nominal diameters of 28.0 and above, dimension L1 increases by 2.0 mm. Order suffix: AD-S Example: BMD-S10-CR-35.0-AD-S

Covers for type D Dimension L1 increases by 1 mm. Order suffix: AD-D Example: BMD-D10-CR-35,0-AD-D

Covers for type FB BMD-FB6: Dimension L1 increases by 0.5 mm. For series BMD-FB10, nominal diameters 15-28 mm, dimension L1 increases by 0.5 mm and for nominal diameters of 28 mm by 2 mm. Order suffix: AD-FB Example: BMD-FB10-CR-35.0-AD-FB

()) INDUSTRIE 4.0

 $\mathbf{r}$ 

Plastic contact points (MKK)

be used only under certain

The contact points consist of

polyamide balls (Ø 4.0 mm).

These gauging contacts should

specific conditions, e.g. for highly

These elements can be replaced

Available for nominal diameters

of 25.0 mm and above. Type S

Maximum measurement range:

Service life depends upon such

conditions as workpiece surface

material, length of the measured

bore, measuring pressure, etc.

Up to 1,000,000 measurements

quality (roughness, coating),

are possible under optimum

(extra charge)

polished surfaces.

by the customer.

or D only.

Example:

MB-SO+0.3

Order suffix: MKK

**Service life** 

conditions.

BMD-S10-CR-35.0-MKK



PK-ZHML

#### **Reduced cylinder** diameter tolerance (MZ) (extra charge)

The manufacturing tolerances for guide cylinders indicated for BMD types S and D (10/11) are reduced to 0.01 mm (±0.005). The purpose is to reduce axial and radial errors to a minimum. This option should be used only for very small bore tolerances (to approx. 0.01 mm). Cylinder production tolerance (min. bore diameter -0.01) ±0.005 mm Order suffix: MZ The MZ dimension is approx. 0.01 mm lower than the minimum bore diameter (= nominal BMD

#### diameter). Example: Min. bore diameter = 35.0

MZ diameter = 34.99 BMD-S10-35.0-MZ-34.99 The guide cylinder is manufactured with a diameter of Ø 34.99 ±0.005 mm Range of application Ø 4,0 – 100,0 mm. Other diameter dimensions on request.

#### Inspection plug gauge (BM) (on request, extra charge)

The inspection plug gauge is a full-form GO gauge used to measure minimum bore diameter. If the inspection gauge can be inserted into the bore, the exact actual diameter as well as any shape defects are shown on the indicator. Series 6 Ø 8.0 – 20.0 Ø >20 - 100.0 Series 10 Quality ISO6 or to customer

specification

Important dimension-based codes for special types

A	Length of pilot taper 15°/30° ( 14)
AD	Cover AD-S, AD-D
AT0	toleranced connecting length

- L1 Length from contact midpoint to BMD face
- L2 Length from contact midpoint to cylinder end
- 13 Length from contact midpoint to depth stop
- L4 Length from contact midpoint to end of threading
- MB-B Measurement range limitation
- Extended measurement range MB-SO
- Limited Z dimension ΜZ
- MR-SO Special gauging contact radii
- ØZ Actual diameter of BMD cylinder

#### **BMD** without inherent gauging pressure (PG)

Without an indicator, BMD plugs have an inherent gauging pressure of approx. 0.2 - 1.7 N. In option PG – without inherent gauging pressure - the built-in probe is not pre-extended. The contact points are retracted beneath the surface of the guide cylinder. This option should be selected e.g. for use with sensitive or rough workpiece surfaces. Please note:

Indicator gauging pressures must be higher, as the probe exerts no pressure of its own. Option PG should be used in conjunction with the following accessories: Holders:

MH-6-73-R	24
MH-10-150-R	🗊 25
MH-10-150-PG	132
Order suffix: PG	
Example:	
BMD-S10-35.0-PG	

#### **Toleranced connecting** length (AT0) (extra charge)

Depending on how the gauging unit is installed, the needle may protrude at different lengths (differences of up to 1.0 mm). Especially when electronic probes are used, the gauge has to be readjusted in the holder when the plug gauge is changed (electrical zero point). In order to avoid this problem, the dimension from the stop collar to the needle is adjusted with a tolerance of ±0.02 in option AT0. The adjustment is made in the setting ring at the nominal dimension. This option requires that the setting ring be ordered with the component.


#### Please note:


If the plug gauge is used with such accessories as depth extensions, right angle attachments, etc., option AT0 must cover the entire unit (accessories are not interchangeable).

#### **BMD** series AT0 Series 4 12.55 ±0.02 Series 6 12.18 ±0.02 $21.96 \pm 0.02$ Series 10 Order suffix: AT0 Example: BMD-S10-35.0-AT0 BMD-S10-35.0+TV-15-64-AT0

#### Note:

Dimension AT0 changes as a result of mechanical wear.

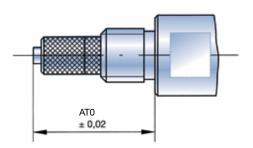

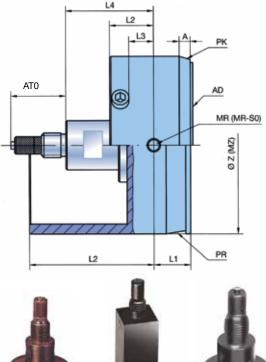





SO-KO

PA6

FB-10



In diameters of up to 44.0 mm, the guide cylinder and the threaded connection fittings are produced as a single part. In plug gauges with nominal diameters larger than 44.0 mm, guide cylinders and the threaded connection fittings are manufactured as separate parts.

The basic plug gauge types are generally used as manual measuring device and are thus produced with entry grooves which prevent the gauge from jamming as it enters the bore. Series 4 BMD have no entry grooves.



Our Basic plug gauge types are divided into three groups:

# 1. Basic plug gauge for general-purpose gauging

Due to its short L1 dimension, this type is not suitable for measurement from the lip of the bore (10).

# 2. Basic plug gauge for all through bores

This type of plug gauge should always be used for workpieces with through bores. Another advantage is that the enlarged L1 dimension allows reliable measurement from the lip of the bore (11).


# 3. Basic plug gauge for blind bores

This type of BMD should always be used when measurements are to be made near the bottom of the bore or when bores are very short. For very short bores, the entry groove should be reduced in size or eliminated entirely (Type OR). The BMD-FB plug gauge is produced in versions FB-6 (connection threading M6 x 0.75) and FB-10 (connection threading M10 x 1) and is available in nominal diameters of 7.0 mm and above ( $\blacksquare$  12).

Smaller bore diameters require the use of Type BMD-S4-S-FB.

#### **Insertion aids**

In order to facilitate insertion of the plug gauge into the bore, DIATEST offers optional entry grooves (PR) and pilot tapers (PK). An entry groove is the standard solution for preventing jamming during manual measurement. For automatic measurement or use in measuring systems, the pilot taper is used in conjunction with a floating holder (see 147). For very short bores (in which an entry groove cannot be used) the cylinder is bevelled (Option OR, see 15).

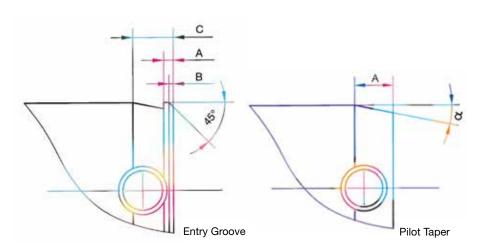

**Pilot taper dimensions (PK)** 

Nom. diameter range

3.95 - 6.0

-

7.0 - 9.0

9.0

6.0

9.0 - 20.0

15.0 - 70.0

70.0 - 270.0

Typ S4-S-FB and FB: on request

Series

4

4

6

6

10

10

>

>

>

>

#### **Entry groove dimensions**

Series	Non	n. diam	ete	r range	A	В	С
6	>	7.0	-	10.0	0.5	0.3	1.9
6	>	10.0	-	20.0	0.6	0.3	2.0
10	>	15.0	-	25.0	0.9	0.5	3.7
10	>	25.0	-	44.0	1.1	0.5	4.6
10	>	44.0	-	70.0	1.5	0.5	6.5
10	>	70.0	-	100.0	2.0	0.5	10.0
10	>	100.0	-	270.0	2.0	0.5	11.0

#### Sample applications for 2-point and 3-point BMD



2-point plug gauges for standard applications (bore diameter, shape deviations), special: oval



Type D

α

8°

8°

8°

15°

15°

15°

Α

1.5

3

3.5

3.5

4

4.5

3-point plug gauges: for polygon only

Type S / S-FB

1,1

1,1

1,9

1,9

30°

30°

15°

15°

15°

15°

A (S) A (S-FB)

0.4

0.8

2.5

2.5

3

3.5

0

#### **S4**


S

#### Nominal diameter range: Ø 2.98 - 9.0 mm

Ø Z = Nom. diameter - 0.02 / - 0.04

Sample order:	
Bore diameter	Order Code
7 D6	BMD-S4-CR-7.04
<b>.</b>	


Diameters less than 2.98 with T-BMD (17)

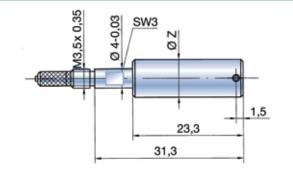

#### Nominal diameter range: 7.0 - 20.0 mm

)4

Sample order:		
Bore diameter		Order Code
10 H6		BMD-S6-CR-10.0
Nom. diameter		>8.0 - 20.0
ØD	6.8	7.9
SW	6	7

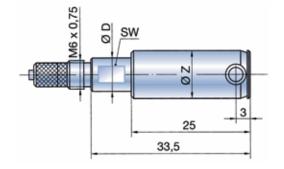

#### **S10** Ø 15 - 44 mm


#### Nominal diameter range: above 15.0 - 44.0 mm

Nom. diameter Ø 15 - 32.0 Ø Z = Nom. diameter - 0.02 / - 0.05

Nom. diameter Ø > 32 - 44.0 Ø Z = Nom. diameter - 0.03 / - 0.06

#### Sample order:


Bore Order Code 40 - 0.007 / + 0.025 BMD-S10-CR-39.993

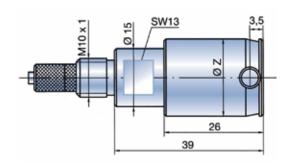

#### **S10** Ø > 44 - 70 mm

#### Nominal diameter range: above 44.0 - 70.0 mm

Ø Z = Nom. diameter - 0.03 / - 0.06	
Sample order:	
Bore	Order Code
50 R7	BMD-S10-CR-49.95

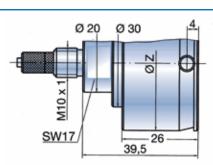

#### S10 Ø > 70 - 270 mm

#### Nominal diameter range: above 70.0 - 270.0

Nom. diameter > 70 - 200

Ø Z = Nom. diameter - 0.04 / - 0.07


Nom. diameter > 200 - 270

Ø Z = Nom. diameter - 0.06 / - 0.10

Sample order:

Bore Order Code BMD-S10-CR-124.96 125 - 0.04

Nominal diameters over Ø 270 mm on request

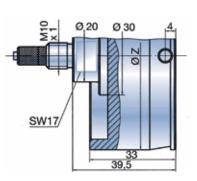

٢C

**S6** 



0


D

#### Nominal diameter range: Ø 2.98 - 9.0 mm

Ø Z = Nom	. diameter -	0.02 / - 0.04
-----------	--------------	---------------

Sample order:	
Bore diameter	Order Code
5 N8	BMD-D4-CR-4.98


Diameters less than 2.98 with T-BMD (17)

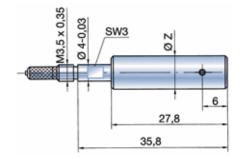

**D6** 

#### Nominal diameter range: 7.0 - 20.0 mm

Ø Z = Nom. diameter - 0.02 / - 0.04		
Sample order:		
Bore		Order Code
10 + 0.04		BMD-D6-CR-10.0
Nom. diameter	7.0 - 8.0	8.0 - 20.0
ØD	6.8	7.9
SW	6	7

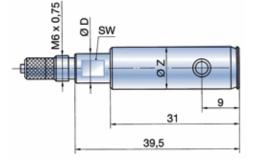

#### D10 Ø 15 - 44 mm

#### Nominal diameter range: above 15.0 - 44.0 mm


Nom. diameter Ø 15 - 32.0 Ø Z = Nom. diameter - 0,02 / - 0,05

Nom. diameter  $\emptyset > 32 - 44.0$ 

Ø Z = Nom. diameter - 0.03 / - 0.06

Sample order:


eample eraen	
Bore	Order Code
42 K8	BMD-D10-CR-41,97

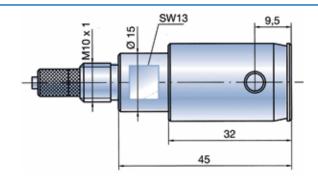

#### D10 Ø > 44 - 70 mm

#### Nominal diameter range: above 44.0 - 70.0 mm

Ø Z = Nom. diameter - 0.03 / - 0.06	
Sample order:	
Bore	Order Code
60 JS8	BMD-D10-CR-59.777

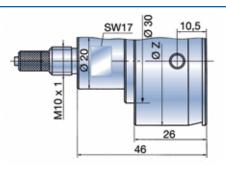

#### D10 Ø > 70 - 270 mm

#### Nominal diameter range: above 70.0 - 270.0 mm

Nom. diameter > 70 - 200

Ø Z = Nom. diameter - 0.04 / - 0.07

Nom. diameter > 200 - 270


Ø Z = Nom. diameter - 0.06 / - 0.10

#### Sample order:

 Bore
 Order Code

 100 H7
 BMD-D10-CR-100.00

Nominal diameters over Ø 270 mm on request

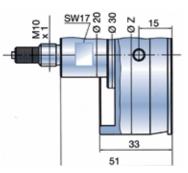

FB6

We recommend version PG for BMD type FB (see 10 8)


Ø 7,0 - 16,0 mm

#### Nominal diameter range: above 7.0 - 16.0 mm

Nom. diameter Ø 7.0 - 16.0

Ø Z = Nom. diameter - 0.02 / - 0.04

Sample order:	
Bore	Order Code
9 K8	BMD-FB6-CR-8.984

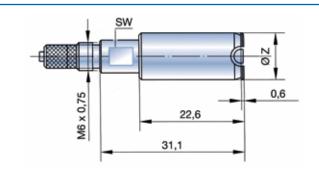

Contact points only available in MHM or MCR


#### **FB10** Ø 15,0 - 44,0 mm

#### Nominal diameter range: above 15.0 - 44.0 mm

Nom. diameter Ø 15.0 - 32.0 Ø Z = Nom. diameter - 0.02 / - 0.05

Nom. diameter Ø > 32 - 44.0 Ø Z = Nom. diameter - 0.03 / - 0.06

Sample order: Bore Order Code 42 K8 BMD-FB10-CR-41.973

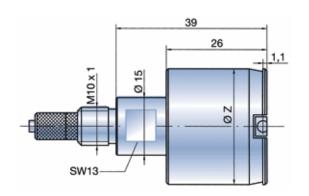

Contact points only available in MHM or MCR


#### FB10 > Ø 44,0 - 70,0 mm

#### Nominal diameter range: above 44.0 - 70.0 mm

Ø Z = Nom. diameter - 0.03 / - 0.06

Sample order:	
Bore	Order Code
60 JS8	BMD-FB10-CR-59.977

Contact points only available in MHM or MCR

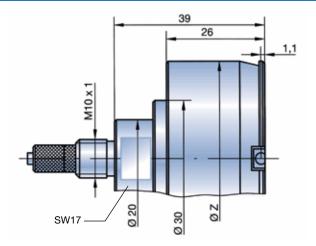


#### **FB10** > Ø 70,0 - 150,0 mm

#### Nominal diameter range: above 70,0 - 150,0 mm

Ø Z = Nom. diameter - 0.04 / - 0.07	
Sample order:	
Bore	Order Code
100 H7	BMD-FB10-CR-100.00

Contact points only available in MHM or MCR

Nominal diameters over Ø 150 mm on request

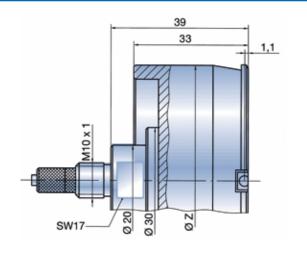

**P**C



DIATEST exclusively produces plug gauges with mechanical measurement systems. Type L (air supply) gauges are designed to provide for workpiece cleaning at the contact points and to reduce contact bore fouling. All gauges equipped with an air cleaning system are produced with covers. This increases dimension L1. DIATEST supplies an aluminum cover as a standard component. All dimensions not otherwise specified are the same as for basic types S and D. Required air pressure: 2-3 bar. Accessories for BMD-L: Holders L-MH10-150 (1) 30), Depth extensions L-TV8, L-TV15, L-TV15-A (1) 37/38), Right-angle attachments L-W10 (1) 36), Adapter A6-10-L (1) 35)

L-S6
L-D6

L-S10

L-D10

Ø	7,0 - 20		

Nom. diameter range: 7.0 - 20.0 mm Covers for Series L-S6 are glued into place

or Series L-S6 are	glued into place
Type S	L1 = 3.5 mm
Type D	L1 = 9.5 mm



>	Ø	15	- 44	mm

#### Nom. diameter range: 15.0 - 44.0 mm

Covers for Series L-S10 up to nom. diameter of 28.0 mm are glued into place.


Type S10 > 28 mm and Type D are bolted in place

 Type S
 Ø
 15.0 - 28.0 mm
 L1 =
 4.0 mm

  $\emptyset > 28.0 - 44.0 mm$  L1 =
 5.5 mm

 Type D
 L1 =
 10.5 mm


L1 = 11.5 mm



#### L-S10 > Ø 44 - 70 mm L-D10 Nom. diameter i

Nom. diameter range: 44.0 - 70.0 mm Cover bolted Type S L1 = 6.0 mm

Type D



L-S10 Ø	70 - 270 mm		
L-D10 No	m. diameter rar	nge: 70.0 - 270.0 mm	
Cov	er bolted		
	Type S	L1 = 6.0 mm	
	Type D	L1 = 16.0 mm	ě TL IIII
			Σ I




#### L-FB10

## Ø 15 - 150 mm

Nom. diameter range: 15.0 - 150.0 mm Covers glued up to nom. diameter 28.0 mm, bolted above 28.0 mm.

Ø 15-28	L1 = 1.6 mm
Ø > 28 - 150	L1 = 3.1 mm





mated testing units, etc.

used wherever possible:

(= larger floating range)

• The gauging contacts are

positioned behind the pilot taper,

• Longer pilot taper

Type D plug gauges should be



BMD for automatic gauging -Type PK – are produced with a 30° or. 16° pilot taper instead of an entry groove.

With the aid of matching floating holders, these BMD can be used in measuring systems, transfer lines, CNC machines and auto

Automatic Measurement



Process Integrated Measurement



which makes it easier to insert the contacts into the bore (especially for MB-SO), thus reducing wear. In type S gauges, the contacts are partially inside the taper. Unless otherwise specified,

dimensions correspond to those of the basic types. In the version with air supply – L – dimension L1 is enlarged for the protective cover as indicated in the specification on **7**.


Series	Nom. diameter range Type D Type S		2Z Nom. diameter	Gauging radius	Threading								
					Α	В	α	Α	В	α	minus	R	G
4		3.95	-	6.0	1.5	9	16°	0.4	8	60°	0.2	0.5	M 3.5 x 0.35
4	>	6.0	-	9.0	3	9	16°	0.8	8	60°	0.2	0.5	M 3.5 x 0.35
6		7.9	-	9.0	3.5	12	16°	2.5	11	30°	0.3	2	M 6 x 0.75
6	>	9.0	-	20.0	3.5	12	30°	2.5	11	30°	0.3	2	M 6 x 0.75
10		15.0	-	70.0	4	14	30°	3	13	30°	0.4	2.5	M 10 x 1
10	>	70.0	-	270.0	4.5	18	30°	3.5	17	30°	0.4	2.5	M 10 x 1

**PK** 

#### **BMD** with pilot taper Standard type (no extra charge)

Basic types: Nom. diameter range: Order suffix: Sample order:

S, D, L 3.95 - 270 mm PK BMD-D10-CR-30.0-PK

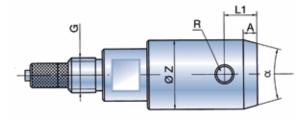

Ø Z as in basic types


#### PK-2Z

BMD with pilot taper and bevelled cylinder (extra charge)

The bevelled cylinder reduces the risk of jamming resulting from deviation of plug gauge angle to the bore axis.

> Basic types: S, D, L 3,95 - 270 mm Nom. diameter range: PK-2Z Order suffix: Sample order: BMD-D10-CR-30.0-PK-2Z-Ø 2Z = 30 - 0.4 mm

Ø Z as in basic types

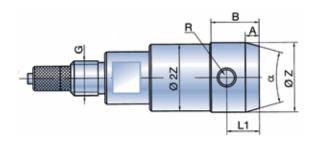

#### **PK-ZHML**

#### BMD-PK with carbide bars (PK-ZHML) (extra charge)

Carbide bars reduce the risk of jamming in fouled bores (e.g. chips in bore).

> Basic types: S, D, L Nom. diameter range: Series 6


Series 10 Ø 18 - 270 mm Ø D Series 6 Nom. diameter - 2 mm

Ø 11 - 20 mm

Ø Z as in basic types BMD gauge cylinder in OCR

Order suffix: PK-ZHML Sample order: BMD-D10-OCR-30.0-PK-ZHML

Series 10

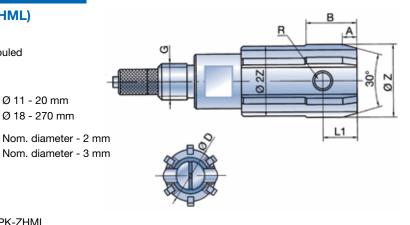



Special-purpose plug gauges are designed to meet specific customer needs. These include either customized products

modifications of basic cylinder types (indicated by "extra charge").

All special types must be specifically requested. Your request should include a precise description of the measurement problem

Order suffix: S-FB

requested L1 = 3.0

Sample order:


Bore

28 H7

and a reliable drawing illustrating the measurement problem. A sample workpiece may be necessary in some cases.

# ()) INDUSTRIE 4.0

#### Order Code BMD-S10-CR-28.0-S-FB-L1 = 3.0 L2

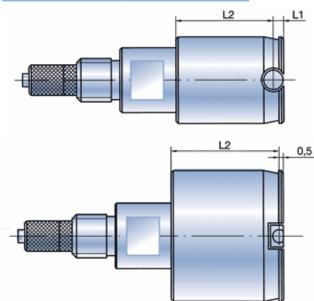

(indicated by "on request") or

#### S-FB

#### BMD for blind bores (extra charge)

In order to measure closer to the bottom of the bore, the guide cylinder of type S or FB is shortened.

L1-dimensions that lie between the minimum length L1 and the standard must be indicated in the order.

#### Type S

#### Nom. diameter range: Ø 4.0 - 270.0 mm

Advantages of type S-FB

The large gauging radii of type S are used. This facilitates insertion of the plug gauge into the bore and helps to reduce wear.

Ø Z = nom. diameter same as for type S. L2 same as for type S

BMD gauge type	Min. length L1
Series 4	0.6 mm (Ø 4.0 and above*)
Series 6	1.6 mm
Series 10	2.4 mm

\*) for  $\emptyset < 4,0$  type T-BMD-FB can be realized Series 10 - 3P: L1=3.0 Series 6 - 3P: L1=2.0

#### **FB-S-FB** Nom. diameter range: 15.0 - 150.0 mm

Ø Z = nom. diameter as in type FB.

Minimum length L1 = 0.5 mm. At L1 = 0.5 mm, the gauging contact has a sharp edge, which results in heavier wear. If the workpiece is also sharpedged, Option PG should be used (fin 8). Available only in type BMD-FB10.

#### OR

#### **BMD** without entry groove


(no extra charge)

When used in very short bores, the entry groove cancels out most or all of the guide function.

Order suffix: OR

Sample order:	
Bore	Order Code
30 H6	BMD-S10-CR-30.0- OR-chamfer 0.5 x 45°

In this case, use of an entry groove is not recommended. The cylinder should be bevelled in order to prevent jamming. Basic types: S, D, FB, S-FB, L

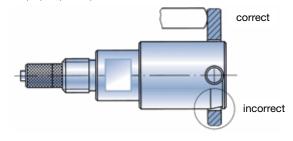


#### UM

#### **BMD** with reduced entry diameter

(extra charge)

Nom. diameter range: 7.9 - 270 mm The BMD can be inserted to the end of the front cylinder before the finished dimension is reached. thus making it possible to gauge the machine stop point. The entire BMD can be inserted into the bore beyond the finished dimension.

Basic types: S, D	Order suffix: UM
Sample order:	
Bore	Order Code
30 H7	BMD-S10-CR-30.0-UM

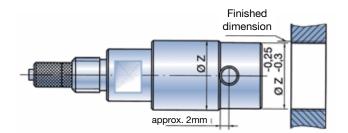

#### **2**R

3P

SO


#### BMD with 2 entry grooves

(extra charge)

This option prevents jamming when the BMD is retracted from ribbed workpieces or interrupted bores.

Basic types:	S, D, FB, S-FB, L
Nom. diameter range:	7.0 - 270 mm
Order suffix:	2R
Sample order:	

Bore	Order Code
10 H6	BMD-S6-CR-10.0-2R



#### 3-point BMD (extra charge)

3-point plug gauges are required in order to detect polygonal shape defects.

The gauging contacts are spaced at 3  $\times$  120°. Different spacing available on request.


The inner probe is mounted on a pendulum bearing in order to allow the gauging unit to center itself in the bore.

Basic types:
Diameter range:
Sample order:

S, D, L 8.0 - 100 mm BMD-S10-CR-35.0-3P

The dimensions of the BMD correspond to those of the basic types in Series 6 and 10.

Due to its specific design, the gauging accuracy of the 3-point BMD is slightly less than that of the 2-point gauge (see 15). Therefore, a 2-point plug gauge should be used wherever possible.




#### SO-TA

#### BMD with depth stop (extra charge)

3 carbide stop bolts set at 3 x 120° angles.

Basic types:	S, D, S-FB, L-FB, FB
Order suffix:	SO-TA-L3
Sample order:	BMD-D10-CR-28.0-SO-TA-L3 = 11

Please indicate dimension L3 in your order.



#### **Table for SO-TA**

Nom-Ø	Туре	max. L3	Туре	max. L3	D	н	G
12 - 20	S6	16	D6	16	5	2	M3
20 - 32	S10	16.5	D10	16.5	5	2	M3
> 32 - 44	S10	16.5	D10	16.5	7.5	3.5	M5
> 44 - 70	S10	14.5	D10	8	7.5	3.5	M5
> 70 - 270	S10	21.5	D10	10.5	7.5	3.5	M5



#### **T-BMD**

#### **BMD** for small dimensions

(extra charge)

	<b>U</b> /	
Types: Sta	andard, FB and PA	
	Nom. diameter ranges:	
	Standard, FB	Ø > 2.0 - 3.0
	PA	ll 1.0 - 3.0


Ø Z = Nom. diameter -0.02/-0.04

#### Standard, FB

Nom. diameter	LM	L1	L1 (FB)	L
Ø 2.0 - 2.50	21.5	1.1	0.5	30.5
Ø > 2.50 - 3.0	27.0	1.4	0.5	35.8

PA

Nom. diamter	LM	L1	L1 (FB)	L
II 1.0 - 1.5	4.5	0.8	-	24.7
ll > 1.5 - 2.49	4.5	1.1	0.5	30.5
II > 2.49 - 3.0	4.5	1.4	0.5	35.8

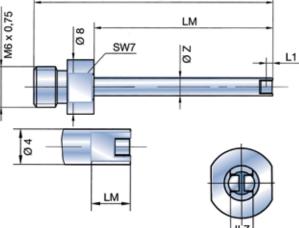

only in MCR

MHM and MCR

with MCR, from II 1.51 also MHM

T-BMD-2.55 · T-BMD-PA-2.38

Gauging contacts:

Measurement range: + 0.15 mm

FB:

PA:

Standard:

Sample order:

L





#### ZKUL

#### BMD with plastic bars (on request)

Designed for use with very sensitive surfaces (e.g. polished hydraulic bores, etc). MDI or MKK gauging contacts may be required.


Basic types:	S
Nom. diameter ranges:	S
	~

5, D, L Series 6 Ø 11 - 20 mm Series 10 Ø 18 - 270 mm

ØD Series 6 Nom. diameter - 2 mm Series 10 Nom. diameter - 3 mm

Ø Z same as for basic types

Order suffix: PK-ZKUL Sample order: BMD-D10-OCR-30.0-PK-ZKUL

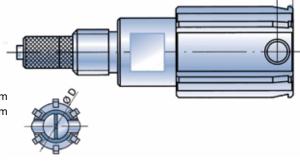


#### SO-DZL

#### BMD with long cylinder (extra charge)

In versions with air supply - L - length L1 increases by 1 mm.

Basic types: D, L Nom. diameter ranges: 3.95 - 44 mm BMD-S6-CR-10.0-SO-DZL Sample order:



SO-ZL


#### BMD with extended cylinder (on request)

Basic types: S, D, L Nom. diameter ranges: Ø 3.95 - 270 mm

- For requests, please mention the following lengths: L1 max. 200 mm
- L2 up to nom. diameter 23.0 max. as in L4 Nom. diameter > 23.0 max. 200 mm
- L4 cannot be changed

#### Sample order:

BMD-S10-CR-39.997-SO-ZL-L1 = 25-L2 = 50

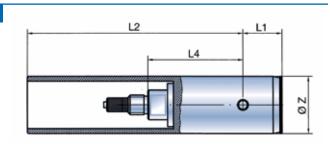

For large L2 lengths, a TV15 depth extension may be required.

#### SO-KO

SO

#### BMD for tapered bores (on request)

All BMD-SO-KO plug gauges must be used with a depth stop (e.g. SO-TA, etc.). When ordering with an SO-TA, please indicate length L3. The BMD can only be produced on the basis

of a tapered master ring or a good sample workpiece with corresponding minimum tolerance.

Clearance A is approx. 0.05 mm at minimum bore diameter. Please furnish a workpiece drawing with inquiry.

Basic types:S, D, FB, S-FB, LNom. diameter range:4 - 100 mmMax. angle:approx. 30°



#### SO-2Z

#### BMD with 2 guide cylinders (on request)

Type SO-2Z is used to reduce centering errors when working with short bores by using a second bore for support.

 Basic types:
 S, D, FB, S-FB, L

 Nom. diameter range:
 3.95 - 270 mm

 Sample order:
 BMD-S10-CR-49.95-SO-2Z-Ø Z1 = 55.0-L3' = 5

Please furnish a workpiece drawing with inquiry.


#### SO-GL


#### BMD with axial grooves (on request)

The guide pins (1) secure the radial position of the gauging contacts in the groove or the core bore.

Please order the data sheet for SO-GL before placing your request.

Basic types:S, D, FB, LNom. diameter range:6.0 - 270 mm

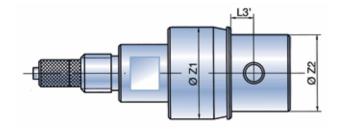

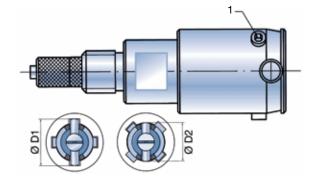

#### SO-FB-SO

# BMD-FB plug gauges for stepped bores (on request)


This gauge type is ideally suited for measuring stepped bores close to the step. The large gauging radii (R = 2.5) are ideal for measuring bores with rough surfaces<sup>\*</sup>.

Please indicate the following in your order:

- L1': Distance from gauging contact midpoint to step (min. 0.5 mm)
- L1 : Standard as for type S or D
- ØD : Diameter of the staggered cylinder

Basic types: S, D Nom. diameter range: 7 - 270 mm Sample order: BMD-S10-CR-35.0-SO-FB-SO-L1' = 0.5-ØD = 33.0

\* Please use type PG ( 8) if possible.

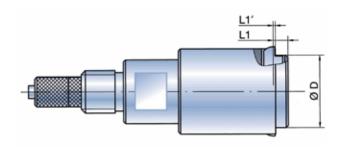

18



#### SO-KW


#### BMD for crankshafts (on request)

For measuring face distance F of connecting rod bearing surface on crankshafts, camshafts, etc.

Nom. diameter range: 8 - 100 mm Types: Type S or FB

Distance: shaft – measuring point X: Type FB: X min. 1.6 mm Type S: X min. 2.9 mm

Please indicate the following values in your inquiry: Dimension F (with tolerance), R, Ø D, X or request data sheet SO-KW. Available in OCR only.

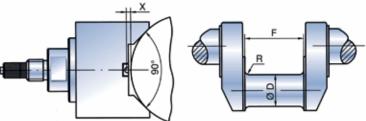


(I) INDUSTRIE 4.0


#### SO-SZ

BMD with special cylinder shapes (on request)

Please enclose a detailed drawing with all requests for gauges of this type.

Basic types: S, D, FB, L, S-FB





#### SO-PA

#### BMD for parallel distances, customized versions (on request)

For distance measurement in workpieces for which the standard BMD PA cannot be used.

Basic types:S, D, FB, L, S-FBNom. size range:4 - 270 mm

Type SO-PA in OCR only

#### EMD


#### BMD for recess gauging (on request)

Plug Gauge for gauging recesses in workpieces from 20 mm. Measuring range from 3,5 to 10 mm (depending on nominal size). Contact points available in carbide (MHM) and chrome (MCR). Please furnish workpiece drawing with inquiry.

Table of measuring range

diameter of bore	max. travel in relation to Ø (results in recess diameter)
20 - 21	3.5
> 21 - 22	4.0
> 22 - 24	4.5
> 24 - 26	5.0
> 26 - 28	5.5
> 28 - 30	6.0
> 30 - 34	7.0
> 34 - 36	8.0
> 36 - 40	9.0
> 40	10.0

Remark: This table is only a rough guideline; deviations depending on shape of workpiece are possible

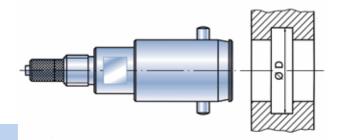


#### BMD-OD


SO

#### BMD for measuring outside diameter (on request)


Plug gauge used to measure outside diameters of ØD between 20 and 100 mm.

Max. measuring depth version 1: 10 mm

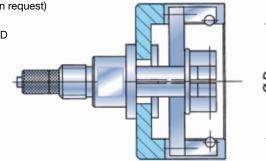



Max. measuring depth version 2: 30 mm

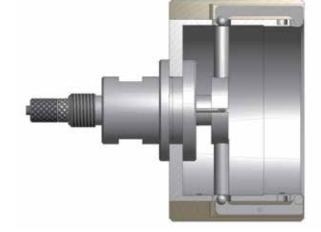

Please enclose a workpiece drawing with your enquiry. We require a sample workpiece or a setting master for production.

#### BMD-IV Ø Zylinder 10 - 100 mm

#### BMD for internal gear gauging (on request)

Measuring of distance between balls (Mi)

Guiding cylinder is adapted to internal  $\emptyset$  of gears. Guiding noses avoid turning of BMD inside the work piece.

Requests required with drawing of workpiece and data about gears: measure Mi, diameter of balls, number of teeth.

For production, we need a GO-workpiece or a setting master with full tooth system. Production is not possible without workpiece or fully toothed setting master!

Versions: type S- or D, special cylinders over Ø 10 mm.







Type PA BMD are hybrid constructions composed of a BMD and a probe: Modified versions of probes from our probe programme are mounted in a guide cylinder. The carbide steel guide cylinder (approx. 62 HRC) is available only in OCR Gauging contacts are

supplied in MCR and - depending on size - also in MHM. For pricing, please note that the price of the needle is added to the price of the BMD for Type PA units.


L1 = 1.8 mm

L1 = 0.8 mm

Required accessories:	Nominal	Measuring
• BMD PA-4	diameter	pressure
Indicator holder MH6-51 (24), Adapter A4-6 (34)	3.0 - 4.2	0.8 - 1.0 N
or depth extension TV4 ( 37)	4.2 - 9.5	1.0 - 1.5 N
• BMD-PA6	9.5 - 20.5	1.2 - 1.8 N
Adapter A6-10-L-PA, otherwise	20.5 - 30.0	1.5 - 2.0 N
as for BMD Series 6	20.0 00.0	1.5 2.01

25\*)

#### **BMD-PA4**

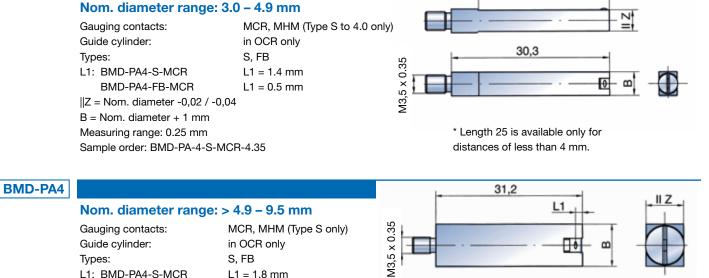

M6 × 0,75

||Z = Nom. diameter -0,02/-0,04 B = Nom. diameter + 1 mm, Measuring range: 0.25 mm Sample order: BMD-PA4-S-MHM-6.3

L1

ΠZ

48,8

||Z = Nom. diameter -0,02/-0,05

Measuring range: 0,3 mm

B = 12.0 mm

#### **BMD-PA6**

Nom. diameter rang	ge: > 9.5 – 30 mm
Gauging contacts:	MCR, MHM
Guide cylinder:	in OCR only
Types:	S, FB

<b>J</b> 1 <sup>2</sup>	- /
L1: BMD-PA6-S-MCR	L1 = 3.5 mm
BMD-PA6-S-MHM	L1 = 3.5 mm
BMD-PA6-FB-MCR	L1 = 1.0 mm
BMD-PA6-FB-MHM	L1 = 1.0 mm


#### Needle für BMD-PA4

BMD-PA4-S-MHM

BMD-PA4-FB-MCR

Carbide needle (without groove) for BMD-PA4-S-MCR and BMD-PA4-S-MHM = Order Code NT-HM-PA1-150


Carbide needle (with 2 grooves) for BMD-PA4-FB-MCR = Order Code NT-FB-HM-PA1-150





Carbide needle (with one groove) for BMD-PA6-S-MCR and BMD-PA6-MHM = Order Code NHM3-310

Carbide needle (with 2 grooves ) for BMD-PA6-FB-MCR and BMD-PA6-MHM = Order Code NFB-HM3-310



Multiplane plug gauges are capable of measuring up to 8 bore dimensions simultaneously. ME-BMD types are

available for use in manual gauging (with entry groove) or for automatic bore gauging (with pilot taper PK).

All multiplane plug gauges are special BMD gauges and are

configured for specific measurement applications. Therefore, your enquiry should include all workpiece data, such as:

- bore drawing or detail
- workpiece material
- position of measuring points The most important currently available primary dimensions, distances and gauging contact

configurations are listed in the table below. Deviations are possible under certain conditions, however. Please ask! Multiplane plug gauge characteristics:

- Gauging radius R = 4.5 mm; with pilot taper (PK) R = 2.5 mm
- Linearity and repeatable accuracy may deviate from the

standard (due to the asymmetrical configuration of the mechanical gauging elements).

- Hard chrome coated cylinder
- Steel cover L = 1.0 mm
- Depth measuring possible on collar or bottom

#### BMD-ME

#### **Primary dimensions**

Specific dimensions, e.g. minimum length (6.5 mm) or minimum diameter, of the individual guide cylinders can be reduced under certain circumstances. The radial configuration of the gauging contacts is shown in the table below. Different connection types are listed in the table below.

#### Inquiries

In order to prepare an offer, we require a workpiece drawing with the following information:


- 1. Distance from gauging planes to a workpiece reference edge
- 2. Radial/angular position of gauging contacts see table
- 3. Bore diameter, tolerance and the desired measuring range
- 4. Type of connection


#### **Connection types**


Depending on the specific application (manual gauging, installation in a gauging system, etc.), multiplane BMD can be fitted with different types of connections.

Connection threadings will also differ depending upon the number of gauging planes (see 123). The most commonly used connections are listed below.

Other connection dimensions and types are available on request. The type 5, size 2 connection is required for the BMD-ME plug gauge with floating holder for multiplane BMD gauges (SH-BMD-ME).

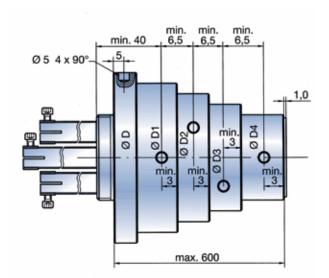

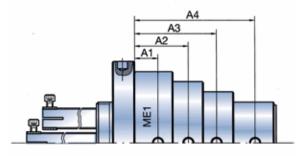

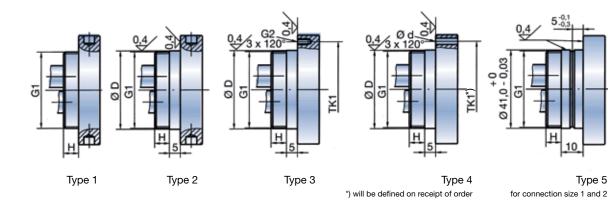



#### L

22



#### **Connection dimensions for multiplane BMD**

Connection size	Thread (G1)	Thread height (H)	Ø D + 0/-0,03	Thread (G2)	Pitch diameter (TK1)
1	M35 x 1.5	7 mm	36 mm	M5	52 mm
2	M40 x 1.5	8 mm	41 mm	M5	57 mm
3	M52 x 1.5	10 mm	53 mm	M6	70 mm

The following table shows current available minimum guide cylinder diameters for the individual measurement planes. Deviations from these dimensions are possible in specific cases.

#### Minimum diameters for multiplane BMD

Туре	Min. possible cylinder Ø				Angular p	Angular position of contacts in plug cylinder				
	ØD	Ø D1	Ø D2	Ø D3	Ø D4	ME 1	ME 2	ME 3	ME 4	
BMD-1ME	37.5	15				0-180°				1
BMD-2ME-13-10	37.5	22	22			0-180°	0-180°			1
BMD-2ME-13-12	37.5	30	30			0-180°	0-180°			1
BMD-2ME-15-9	37.5	32	24			0-180°	0-180°			1
BMD-2ME-15-18	37.5	33	30			0-180°	90-270°			1
BMD-2ME-20-1	37.5	35	35			0-180°	90-270°			1
BMD-2ME-20-2	37.5	35				0-90-18	80-270°			1
BMD-3ME-13	37.5	21	21	21		0-180°	120-300°	60-240°		1
BMD-3ME-20	37.5	35	35	35		0-180°	120-300°	60-240°		1
BMD-3ME-0-24-1	46	46	39	8		0-180°	0-180°	0-180°		2
BMD-4ME-20-1	42.5	42	42	42	35	0-180°	0-180°	90-270°	90-270°	2
BMD-4ME-24-26-2	42.5	39	8			as desired f.e. 0-180°	0-180°			2
BMD-4ME-24-26-3	42.5	41	41	41	41	0-180°	90-270°	45-225°	135-315°	2
BMD-4ME-24-26-4	42.5	39				0-90-18	80-270°			2
BMD-4ME-24-26-5	42.5	41	41			0-90-18	80-270°	45-135-	225-315°	2
BMD-4ME-24-26-6	42.5	41	41	41		0-90-18	80-270°	45-225°	135-315°	2
BMD-8ME-20-38	60	60	60	60	60	0-180°	0-180°	90-270°	90-270°	3

Туре	Min. possible cylinder Ø			Angular position of contacts in plug cylinder			Connection size		
	Ø D5	Ø D6	Ø D7	Ø D8	ME 5	ME 6	ME 7	ME 8	
BMD-8ME-20-38	60	60	60	53	45-225°	45-225°	135-315°	135-315°	3

#### BMD-ME

#### **Insertion aids**

Depending on the specific application, multiplane BMD are configured as follows:



- with entry groove for manual gauging (see in 9)
- with pilot taper (30°) for automatic gauging (see 🗊 9)

It is not necessary to affix the entry groove/pilot taper to the first cylinder.

#### **Clean stream nozzle**

With separate air-hose fitting for compressed air supply at up to 10 bar for removal of coarse dirt deposits. The blower nozzle is supplied from an air chamber that is separated from the measurement system.



Please note:

The blower nozzle is not a substitute for a cleaning station. If the workpiece is heavily fouled, additional measures must be taken.

MH6 indicator holders are available in several different designs. They are used for Series 6 BMD and along with adapters (1 34, 35) for series 4 plug gauges (threading M3.5 x 0.35)


#### MH6-51



With clamping fixture

Clamping bore	Order Code
8H7	MH6-51
3/8"H7	MH6-51-Z

Core of holder hard-chrome plated

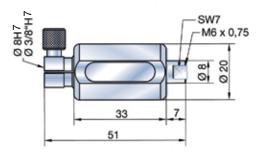




#### Indicator holder with pin retraction

When the button (1) is pressed, the indicator gauging pin is retracted from the BMD pressure needle, removing gauging pressure from the gauge. See also Type "PG", 🗊 8

With clamping fixture

Clamping bore	Order Code
8H7	MH6-73-R
3/8"H7	MH6-73-R-Z

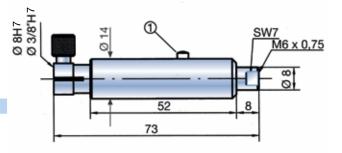


#### **MH6-**

#### Indicator holder for Series 6 BMD, temperature stabilized

The holder is ordinarily equipped with two marking strips.

Туре

Clamping bore	Order Code	Length L	Length A	
8H7	MH6-150	150 mm	25 mm	
8H7	MH6-200	200 mm	75 mm	
8H7	MH6-300	300 mm	175 mm	
3/8"H7	MH6-150-Z	150 mm	25 mm	

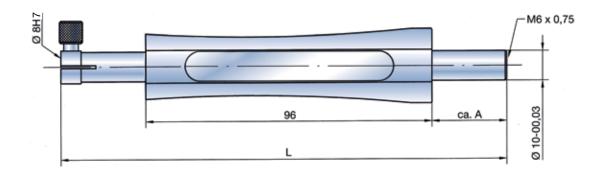



MH10 indicator holders are available in several different designs. They are used with Series 10 plug gauges. When fitted with an adaptor (see  $\blacksquare$  24, 35, the holders can also be used with Series 6 (M6 x 0.75 threading) and Series 4 (M3.5 x 0.35 threading) BMD.


#### MH10-61

Standard indicator holder for Series 10 BMD, without transfer pin

With clamping fixture

Clamping bore	Order Code
8H7	MH10-61
3/8"H7	MH10-61-Z

Core of holder hard-chrome plated

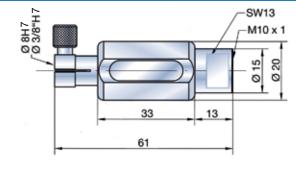

ţ


#### MH10-150

Indicator holder, temperature stabilized

With clamping fixture



The new MH10-150 is supplied with 2 marking strips as standard (BL). The impact protection (see MH10-150-P, 26) can be easily fit: The clamping screw is replaced with an Allan screw. The impact protection is simply affixed and clamped with 2 screws.

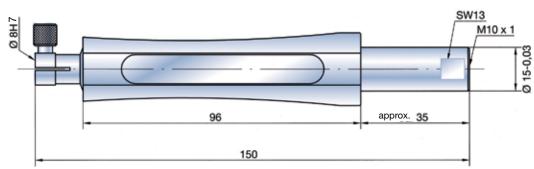

#### MH10-150-R


# Indicator holder, temperature stabilized, with retraction

All dimensions same as for MH10-150, with additional button. By pressing the push button (1) the indicator measuring pin is retracted from the pressure needle of the BMD. The measuring pressure is now removed from the BMD. See also type "PG", (1) 8).


Type MH10-150-R-P with impact protection.

With clamping fixture

Clamping bore	L	Order Code
8H7	35	MH10-150-R
8H7	25	MH10-150-R-P
3/8"H7	35	MH10-150-R-Z
3/8"H7	25	MH10-150-R-P-Z

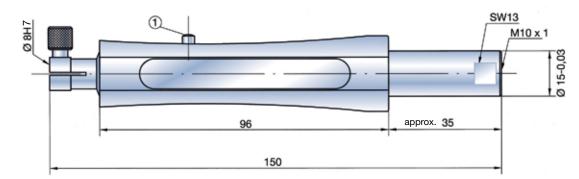

#### MH10 Indicator holders, M10 x 1 and M6 x 0,75 threading

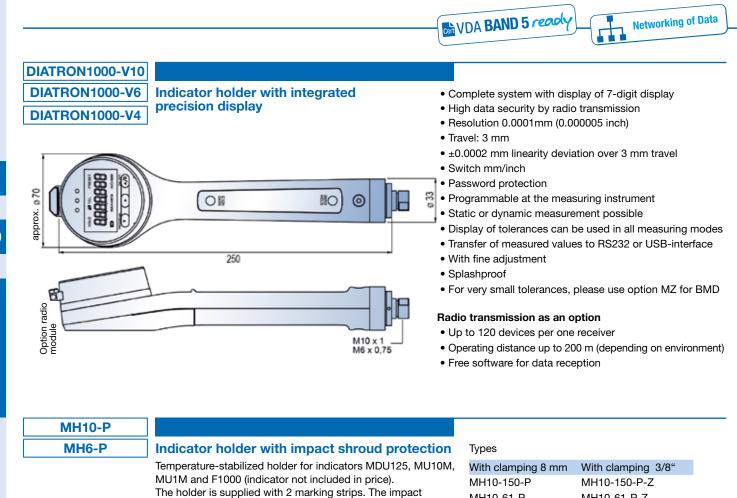


protection can be removed simply by loosening the two clamping screws (see also MH10-150, ill 25).

With clamping 8 mm	With clamping 3/8"
MH10-150-P	MH10-150-P-Z
MH10-61-P	MH10-61-P-Z
MH6-150-P	MH6-150-P-Z
MH6-51-P	MH6-51-P-Z

M6 x 0,75

Ø 10-00,03

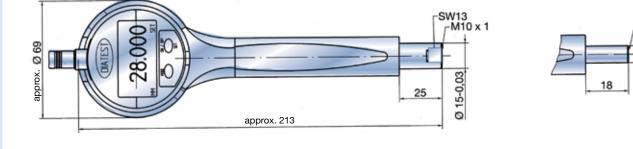

### BL

#### Marking strip BL (extra charge)

A large number of holders are equipped with marking strips as standard (see table). The dimensions indicated below apply to all marking strips except for holder MH10-150-F. A second marking strip can be affixed to several types of holders (e.g. EH, AH, EH-M). Holders which ordinarily do not have marking strips can be equipped with these, if requested. Please enquire.

> Order suffix: 1st strip BL-1 2nd strip BL-2 **Replacement marking strips for holders** (except MH10-150-F) Order Code BLE

Holder	No. of BL	Page 🗊
MH6-51	1	24
MH10-61	1	25
MH6	2	24
MH10-150 (R-P)	2	25/26
L-MH10-150	2	30
MH10-150-R	2	25
EH-V	2	30
EH-V-DS	1	30
MH10-150-F	1	30
MH10-150-P	2	26
MH10-170-D	2	32
MH10-150-PG	2	32
AH6/10-61	1	33
AH6/10-140	1	33
DIATRON1000	1	26
EH-M	1	31



#### **Function and installation**


The complete spring unit with M2.5 threading is installed in place of the indicator stem. The unit is regulated by adjusting the spring nut. The correct gauging pressure setting must be determined by trial and error. The basic approach is to determine the lowest gauging pressure at which acceptable repetition

accuracy is ensured. Please note:

The measuring pressure has to be adjusted in the same position as measurements will be taken later in the workpiece (either horizontal or vertical).


The knurled sleeve on holder MH4-67-F provides excellent protection from breakage for Series 4 BMD.

It also serves as a continuously adjustable depth stop (0 – 20 mm). The holder can also be clamped directly into the clamping fixture, as the protective sleeve has a diameter of 15 - 0.03 mm.

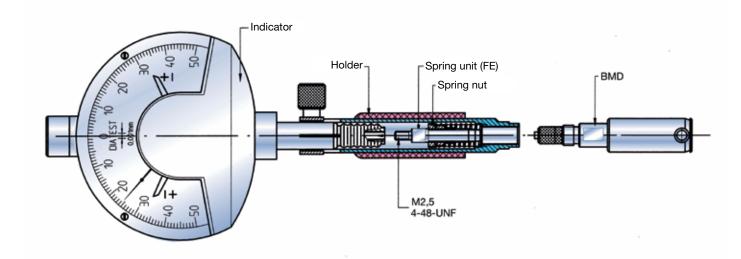

#### Procedure

- 1. Replace the stem of the indicator with the complete spring unit.
- 2. Screw the BMD into the holder and tighten.
- Set the required counterpressure (against the indicator) by adjusting the spring nut.
- 4. Clamp the indicator unit into the holder.
- 5. Test gauging pressure and repeat step 3 as needed.

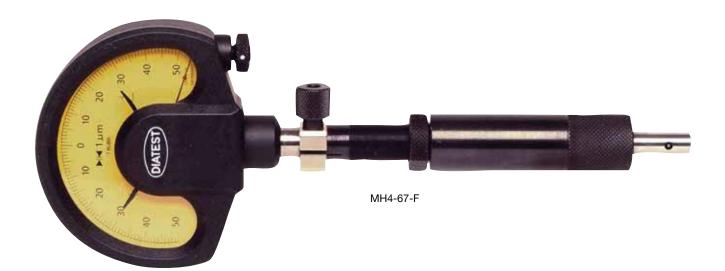

Holders with adjustable spring pressure should be used whenever no indicator with the appropriate measuring pressure is available (see 🗊 6) or when minimum measuring pressure is required for technical reasons (e.g. very thin walled workpiece).


# 1

#### MH4-67-F

#### Indicator holders with adjustable spring pressure for Series 4 BMD

The knurled sleeve (1) protects the BMD and can also be used as a depth stop.

When ordering without BMD please indicate  $\emptyset$  D!

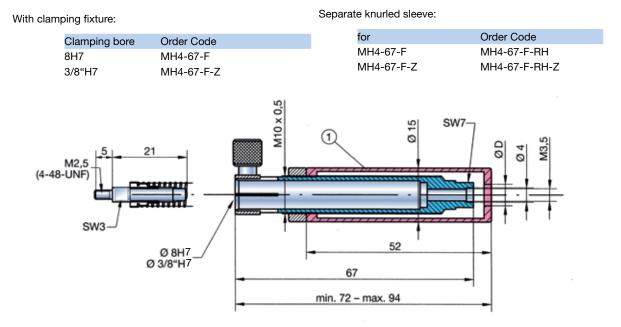


#### MH6-65-F

#### Indicator holders with adjustable spring pressure for Series 6 BMD

#### With clamping fixture:


Clamping bore	Order Code
8H7	MH6-65-F
3/8"H7	MH6-65-F-Z

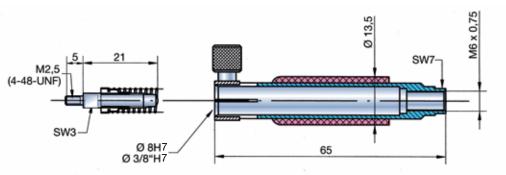




#### Holder configuration and installation

The clamping unit (8) is available in Ø 8H7 or in 3/8"H7. The probe (7) with maximum Ø 12 mm and a maximum length of 140 mm is mounted into holder and protected against shocks. Once probe is installed and cable clamped into cable guides (2), probe cable is protected against excessive cable bending by bend protection (1). Fine adjustment (11) by counter nut (10) can be performed to adjust probe and BMD probe. This allows to position the probe always at the electrical zero point. Holders are equipped with 2 marking strips as standard (version EH-V). One marking strip can be replaced by a membrane keyboard as an option (version EH-V-DS). This version allows to send measured values by pressing a button.

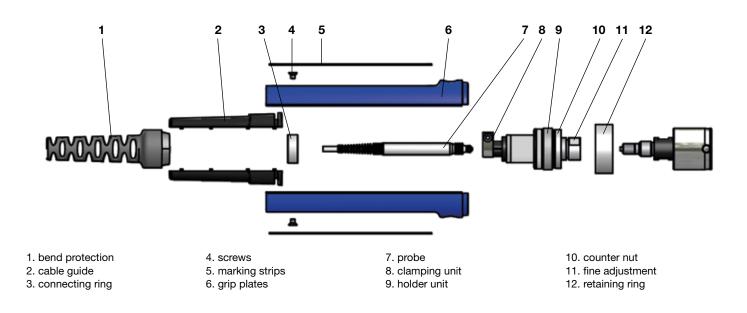

#### Extension and installation for deep bore measurement

The extension is ideal for applications requiring measurement of deep bores in combination with electrical probes. When using a TVT15, it is important to ensure sufficient probe cable length, as a combination with an extension cable inside the TVT15 is not possible. The probe (2) is inserted through the depth extension TVT (4) and clamped in the holder EH10-61 (1). A cable clamp TVT-EHK (5) can be used as a cap (does not apply when using an extension cord, as the probe plug cannot be drawn through the cap). In order to prevent jamming of the BMD in the bore, it is advisable to use clampable support rings (3) – available on request. For extensions and cable clamping fixtures see **1** 39.

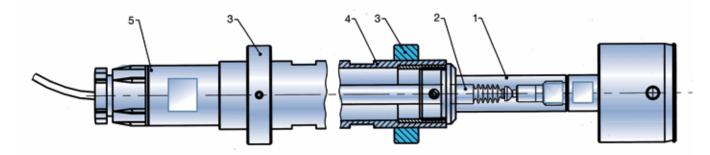

1. Holder EH10-61-T15 EH10-61-T28 2. Probe 3. Support rings 4. TVT- (1) 39) 5. TVT-EHK (1) 39) Electrical holders are used to mount transducers connected to other units, e.g. Diatron 6000, Diatron 2200 or a computer.

EΗ

EH-V

Electrical holder with fine adjustment Clamping bore Connection threading Order Code M6 x 0,75 or M10 x 1 threading 8H7 M3.5 x 0.35 EH-V4 Holder for transducers. The electrical zero point of transducer EH-V6 8H7 M6 x 0,75 can be adjusted without moving it by using the external fine 8H7 M10 x 1 EH-V10 adjustment. 3/8"H7 M3.5 x 0.35 EH-V4 3/8"H7 M6 x 0,75 EH-V6-Z Available with suspension as an option. 3/8"H7 M10 x 1 EH-V10-Z M6 x 0,75 M10 x 1 Ø33  $\odot$ 145 approx.18-24 approx.78 **EH-V-DS Electrical holder with push buttons** Clamping bore Connection threading Order Code M6 x 0,75 or M10 x 1 threading 8H7 M3.5 x 0.35 FH-V4-DS M6 x 0.75 EH-V6-DS 8H7 Type of holder with 2 push buttons for storage of measured 8H7 M10 x 1 EH-V10-DS values. One marking strip and one membrane keyboard are M3.5 x 0.35 3/8" H7 EH-V4-DS-Z mounted instead of 2 marking strips. A cable can be layed on the open end of the membrane keyboard by a zero-force M6 x 0.75 EH-V6-DS-Z 3/8"H7 connector allowing a link to a peripheral device. EH-V10-DS-Z 3/8"H7 M10 x 1 The requested function can be activated by pressing a button (i.e.to send the measured result). Both of the buttons are parallel-connected. ON 80 6 MH Spezial-Messuhrhalter MH10-150-F Indicator holder with With clamping fixture: adjustable spring pressure Order Code Clamping bore 8H7 MH10-150-F Gauging pressure of indicator can be adjusted by approx. 3/8"H7 MH10-150-F-Z ±1 N by adjusting and locking the two grip sleeves (1 and 2) on the holder. This is especially important for measuring of thin-walled workpieces and in order to reduce wear on the BMD contact M10x1

#### L-MH10-150

# Indicator holder, temperature stabilized, for BMD with air supply

points. The holder is ordinarily equipped with 1 marking strip.

For air hoses with an inside diameter of 3.0 mm and an outside diameter of 4.3 mm. Required air pressure: 2-3 bar.


The holders are equipped with two marking strips as standard.

#### With clamping fixture:

Ø8H7 8/8"H7

Clamping bore	Order Code
8H7	L-MH10-150
3/8"H7	L-MH10-150-Z

100 150

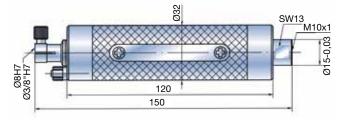


#### 30



#### EH10-61-T15

#### **Probe holder for TVT15**

This holder is suitable only for electrical probes with  $\emptyset$  8H7 clamping fixtures in combination with DIATEST depth extension TVT15. Characteristics as for EH10-61-T28. However, no extension cables can be used inside the TVT15.

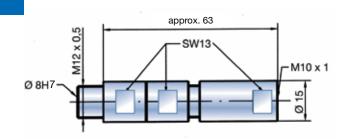

#### EH10-61-T28

#### **Probe holder for TVT28**

This holder is suitable only for electrical probes with  $\emptyset$  8H7 clamping fixtures in combination with DIATEST depth extension TVT28.

Advantage: The measurement is made by the probe on BMD itself, without influence of additional mechanical components between gauge and probe. This makes it possible to perform measurements at depths of several metres with maximum precision. Inside diameter of TVT28 is large enough to allow for connection of a probe plug and an extension cable.

Minimum bore diameter: 28.5 mm.


#### EH10-S EH6-S

# Holder for wireless measuring probe FMTD with radio module FMTD-S

The wireless measuring probe with wireless module can be securely mounted in the holder. The plastic handle prevents the radio module from being shielded.

SW2	925		SW13 M10 x 1
•	╺──	46 61	

Connecting thread	ØD	L
M10x1	15 mm	176 mm
M6x0.75	8 mm	170 mm

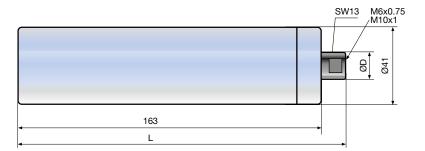


#### EH-M

#### Electrical holders for multiplane plug gauges

These holders are equipped with one marking strip as standard (see 122). Consult the table on 123 for the appropriate model (connecting thread).

Model	Connection size	Threading G	ØD
EH-M35 x 1.5	1	M35 x 1.5	38 mm
EH-M40 x 1.5	2	M40 x 1.5	42.5 mm
FH-M52 x 1.5	3	M52 x 1.5	56 mm

These holders are equipped with one marking strip as standard.

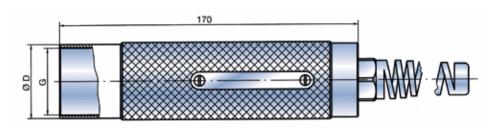

9


#### MH10-170-D

#### Indicator holder with rotating dial

This indicator holder allows 360° rotation of the BMD in the workpiece. The measured value display remains stationary and easy to read. This holder is ideal for testing for oval or polygonal deformation.

The holder is supplied with two marking strips as standard.

With clamping fixture:

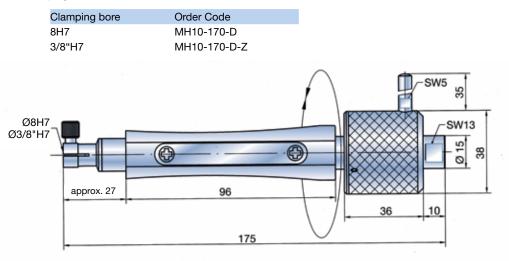

#### MH10-150-PG


# Indicator holder with gauging pressure retraction

Indicator gauging pressure is removed using a bolt (1). BMD type PG (see 10) 8) can be inserted into the bore without contact pressure (helps to reduce wear, particularly advantageous with sensitive surfaces, etc.)

The holder is supplied with two marking strips as standard.


With clamping fixture:


Clamping bore	Order Code
8H7	MH10-150-PG
3/8"H7	MH10-150-PG-Z

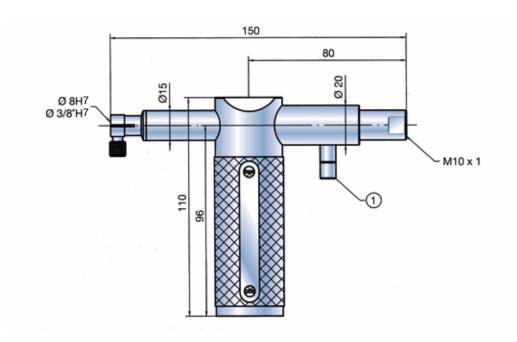



Special holders are available for ANA indicators (ANA1 and ANA-RS232).The indicator is fixed firmly in the holder by a dualtangent clamp. Shifts in the position of the indicator are virtually impossible, even under heavy load conditions. If different measurement indicators are used, the dimension of 41 mm must be maintained. The holders are supplied with one marking strip as standard.

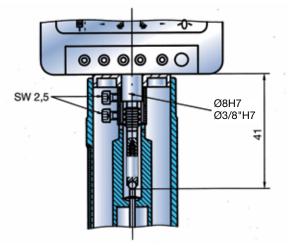

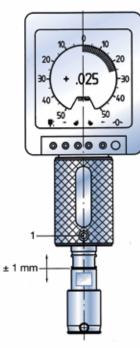

It is practically impossible to shift the display accidentally with analodig holders. Adjustments are performed using the fine adjustment inside the holder. Fine adjustment is secured by tightening the SW3 Allan screw (1). The adjustment range is approximately ±1 mm.


6

#### AH6-61 AH10-61

#### Short holder for the Analodig indicator

Indicator holder without transfer pin

Model	Clamping bore	Connection thread
AH6-61	Ø 8H7	M6 x 0,75
AH6-61-Z	Ø 3/8"H7	M6 x 0,75
AH10-61	Ø 8H7	M10 x 1
AH10-61-Z	Ø 3/8"H7	M10 x 1

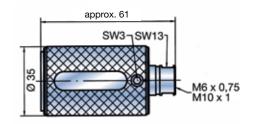


#### AH6-140 AH10-140

#### Holder for Analodig indicator


Indicator with transfer pin

Model	Clamping bore	Connection thread
AH6-140	Ø 8H7	M6 x 0,75
AH6-140-Z	Ø 3/8"H7	M6 x 0,75
AH10-140	Ø 8H7	M10 x 1
AH10-140-Z	Ø 3/8"H7	M10 x 1

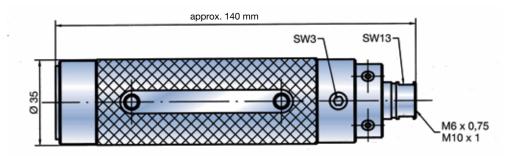



BMD adapters are used to connect BMD gauges with smaller threads to BMD accessories with larger threads. Model SP: With protective bore (fracture protection for the plug gauge). Dimension X = distance between plane surface of plug thread and the adapter threads. In addition to the adapters, depth extensions TV4 and TV3,8 (see 10 37) also function as adapters. Please note: When using adapters, it is important to ensure sufficient indicator pressure, especially with adapters for BMD series 4

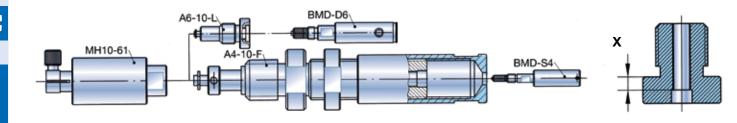


#### Adapters for Series 4 BMD

#### Series 4 to Series 6 adapter

The adapter is designed to be used for BMD-PA as well.

#### X = 1

Adapter with supplementary fracture protection available Order Code A4-6-SP

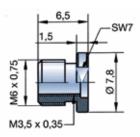

#### A4-10


A4-6

#### Series 4 to Series 10 adapter

**Please note:** This adapter is not suitable for use with series 10 accessories with transfer pins (e.g. TV15 or MH10-150).

X = 3

Order Code A4-10

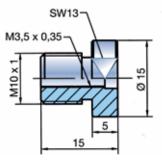


#### A4-10-F

# Series 4 to Series 10 adapter with adjustable spring pressure

Series 4 BMD require a measuring pressure of 0.3 - 0.4 N. A spring in the adapter (1) counteracts the indicator gauging pressure. Spring pressure can be flexibly adjusted by turning sleeve B toward threaded pin A. The sleeve (3) serves as fracture protection and as a depth stop. It can be adjusted continuously from 0 to 20.5 mm. The sleeve is secured with the lock nut (2). For instruction on correct adjustment of minimum gauging pressure see **1** 27.

Please indicate dimension Ø D in orders. Example: A4-10-F-D=7.2 Order Code for separate sleeve (3): A4-10-F-RH

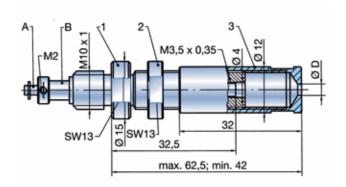



#### Adapters for BMD series 6

#### A6-10-L

Δ

#### Series 6 to series 10 adapter with transfer pin


This adapter is generally recommended for adapting from Series 6 to Series 10:

- The transfer pin permits the use of all series 10 accessories.
- BMD series L

Select model A6-10-L-PA for use with BMD-PA (not shown in illustration).

X = 3

Adapter with supplementary fracture protection available Order Code A6-10-L-SP  $\ensuremath{\mathsf{SP}}$ 

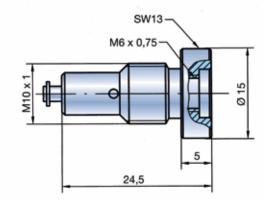

6


#### A6-10-0

#### Series 6 to Series 10 adapter

**Please note:** This adapter is not suitable for use with Series 10 accessories with pressure pins (for instance TV15 or MH10-150).

#### X = 3

Adapter with supplementary fracture protection available Order Code A6-10-0-SP

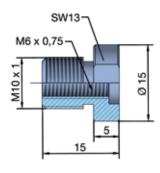


#### A6-6-F

# Adapter for series 6 BMD with adjustable spring pressure

The spring pressure can be adjusted flexibly by turning the sleeve (1).


The sleeve is secured with the lock nut (2). For instruction on correct adjustment of minimum gauging pressure see 27.

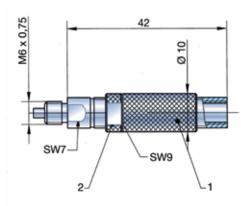



Right-angle attachments are used when working in confined spaces or for measuring lateral bores. The 90° diversion is effected with the aid of a high-precision transfer lever (2). When screwing in the BMD, it is important to ensure that the transfer lever is set in the lower position (see sketch). The angular alignment of the plug gauge contacts (4) with the right-angle attachment (1) is not specified. If a specific angular position is


preferred please specify when ordering.

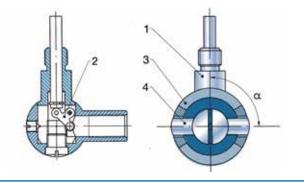

#### **Right-angle attachment for BMD series 6**

An adapter is required for use with BMD series 4. Order Code W6  $\,$ 

Other right angle attachments with angle 45° and 60° also available (similar version) Order Code 45°: W6-45 Order Code 60°: W6-60 Order Code 90°: W6

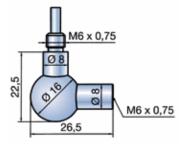


#### SO-W6

**W6** 

# BMD with special right-angle attachment for BMD series 6

If the dimensions of the BMD with right-angle attachments are too long, model SO-W6 can be used as an alternative. In this version, the right-angle attachment and the BMD are shortened in the area of the thread connection. The BMD and the right-angle attachment form a single unit and can be ordered as a complete set only.

**Please note:** Dimension L1 of the BMD has to be added to the length of 51 mm! Sample order: BMD-S6-CR-10-SO-W6

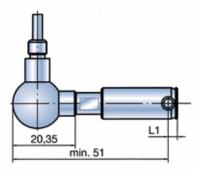


#### W10

# Right-angle attachment for Series 10 BMD

Right-angle attachment L-W10 has to be used with plug gauges with air supply. Order Code W10 (BMD without air supply), L-W10 (BMD with air supply).

Other right angle attachments with angle 45° and 60° also available (similar version) Order Code 45°: W10-45

Order Code 60°: W10-60 Order Code 90°: W10

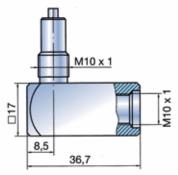


#### SO-W10

# **BMD** with special right-angle attachment for Series 10

Use as described for SO-W6. A shorter version than the minimum length of 60 mm can be achieved by using BMD Series 6 BMD with SO-W6.

**Please note:** Dimension L1 of the BMD has to be added to the length of 60 mm!

Sample order: BMD-S10-CR-28-SO-W10 Also available in model L-SO-W10 (BMD with air supply)

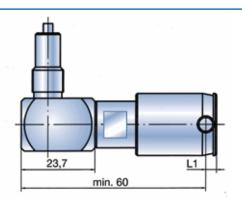





Two different types of depth extensions are available:

- Depth extension with transfer pin (TV)
- Depth extension without transfer pin (TVT)

TV depth extensions can be used for measuring depths of up to several meters, depending on the model.

Most of the depth extensions are temperature stabilized.

This means that temperature fluctuations, e.g. resulting from hand warmth, do not have a noticeable effect on the measuring results. It is important to ensure that the depth extension may not bend during the measuring process, as this will result in measuring errors. Only size TV8 (7, 8) and larger depth extensions are used in combination. The TV4 extension has 2 different connection threadings (adapter function).

Depth extensions TV4 through TV15 are also available with additional pressure springs. This feature may be useful where a BMD with a longer extension is used in overhead work (the weight of the pressure pin counteracts the gauging pressure of the indicator) requiring increased total gauging pressure. The spring can also be installed separately. Order suffix: F e.g. TV15-500-F Type TVT depth extensions are suitable for use with probes only. The probe is clamped directly to the BMD using

EH10-61-T28 (15) holders. The power cable is fed through the extension ( $\bigcirc$  39).

# TV4 (3,8)

#### Series 4 depth extensions


TV4 depth extensions are designed for use with BMD series 4. These depth extensions cannot be used

in combination. They are equipped with two different threads and thus also function as adapters (Series 4 to Series 6).

All series 4 depth extensions are temperature stabilized.

The TV4 is suitable for automatic measurement only under certain conditions.

ØD	L	Α	Order Code
3.8	64	79	TV3.8-64
4.0	25	40	TV4-25
4.0	35	50	TV4-35
4.0	50	65	TV4-50
4.0	64	79	TV4-64

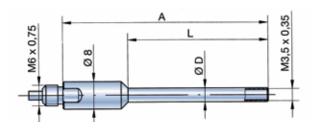


ØD	L	А	Order Code
4.0	80	95	TV4-80
4.0	100	115	TV4-100
4.0	125	140	TV4-125
4.0	250	275	TV4-250
4.0	500	525	TV4-500
4.0	750	775	TV4-750
4.0	1000	1025	TV4-1000

# TV8 (7,8)

#### Series 6 depth extensions

TV extensions with L = 80 and above are temperature stabilized. Multiple extensions can be used in combination.

Select model L-TV8 for use with BMD with air supply. The same dimensions apply: Example L-TV8-64

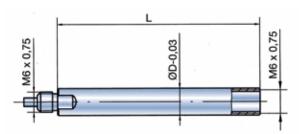

ØD	L	Order Code	ØD	L	Order Code	ØD	L	Order Code
7.8	20	TV7.8-20	8.0	20	TV8-20	8.0	100	TV8-100
7.8	30	TV7.8-30	8.0	30	TV8-30	8.0	125	TV8-125
7.8	40	TV7.8-40	8.0	40	TV8-40	8.0	250	TV8-250
7.8	50	TV7.8-50	8.0	50	TV8-50	8.0	500	TV8-500
7.8	64	TV7.8-64	8.0	64	TV8-64			
			8.0	64	TV8-64-CR			
			8.0	64	TV8-h5-64			
			8.0	80	TV8-80			

# **TV15**

#### Series 10 depth extensions

These depth extensions are temperature stabilized. Multiple extensions can be used in combination.

#### With air supply:

**L** 45

64

80

100

The TV15 for BMD with air supply is available in 2 versions:

1 with lateral air connection for hose internal Ø 3,0 Order Code L-TVA15

125

250

500

Order Code

TV15-125

TV15-250

TV15-500

2 with air connection in threading Order Code L-TV15


Order Code


TV15-45


TV15-64

TV15-80

TV15-100








#### TV64-D

#### **Rotary adapter for series 6**

The rotary adapter enables the BMD to rotate by 360° in the bore. The measured value display remains fixed in place. Application: bore roundness testing.

L Order Code

64



# TV15-70-D


#### **Rotary adapter for series 10**

TV64-D

Same principle as TV64-D. With M10 x 1 connection thread.

Longer size on request.

Order Code TV15-70-D

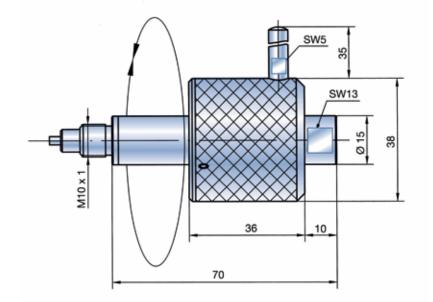

L.





For measuring deep bores in combination with electronic probes (3) and correspondingly long cables or extensions. We recommend the use of support rings (4) to facilitate insertion into the workpiece. These rings should be approx. 0.2 to 0.5 mm smaller than the workpiece bore. The probe is clamped into the EH10-61T holder (2) (see 10 107). The probe cable runs through the depth extension (5) and is clamped in the TVT-EHK cable clamping fixture (6).

The advantage offered by this system is that measured values

5

are recorded directly at the BMD (1). The risk of errors due to extension bending is eliminated.

#### **TVT15**

#### Depth extension with 15 mm outside diameter

TVT15 depth extensions are used in combination with the EH10-61-T15 holder (1) 31). Please note that no probe extension can be used inside the TVT, as the outside diameter of the connector is too large. A probe with a longer connection cable is required for measurement depths of more than 2 m.

- 1		L	
2		L. L	
o'r m	Q.	SW13	
×1	· =	N	
51	0	Ψ.	


L	Order Code
125	TVT15-125
250	TVT15-250
500	TVT15-500

**TVT28** 

#### Depth extension with 28 mm outside diameter

TVT28 depth extensions are used in combination with the EH10-61-T28 holder (1) 31). The inside diameter of the TVT28 is large enough to permit passage of a probe extension cable with coupling (outside diameter approx. 17.2 mm). The TVT28-EHK cable clamp fixture cannot be used with this option!

L	Order Code
125	TVT28-125
250	TVT28-250
500	TVT28-500




# TVT-EHK


#### Cable clamp for TVT15 and TVT28

The cable clamp ensures safe withdrawal of the probe connection cable from the TVT.

**Please note:** The cable clamp cannot be used in combination with a probe extension cable!



TVT15-EHK (for TVT15), Order Code TVT15-EHK




TVT28-EHK (for TVT28), Order Code TVT28-EHK



Depth stops are used to limit measuring depths. They can be clamped to the corresponding depth extension or to the holder.

Example: 1 = Indicator

- 2 = Holder
  - 3 = Depth stop
  - 4 = Depth extension
  - 5 = BMD

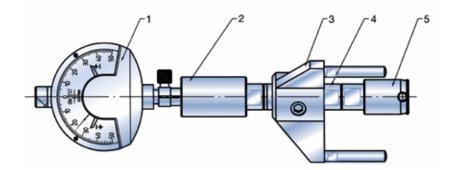


# Depth stop for Series 6

Can be attached to TV8 or holder MH6

#### Sizes:

- TA8 total length 83 mm
- TA8-K total length 45 mm

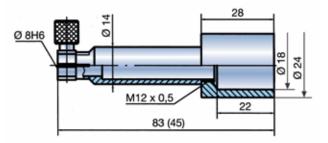

#### **TA15**

TA8


#### Depth stop for Series 10

Can be attached to TV15 or MH10-

Instead of the clamping fixture, the TA15 is also available with M24 x 1 threading (for screw connection to TA15-C or TA15-F, for example).

Order suffix: M24, example: TA15-45-M24

ØD	Order Code	ØD	Order Code
45	TA15-45	160	TA15-160
75	TA15-75	220	TA15-220
110	TA15-110	260	TA15-260

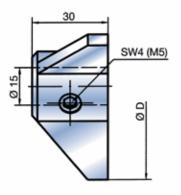

# **TA15-A**

#### Depth stop for Series 10 with 3 stop pins


Can be attached to TV15 or MH10

Special version: Ø d deviating from standard Order suffix: SO-Ød, example: TA15-A-45-SO-Ø d=32

Instead of the clamping fixture, the TA15 is also available with M2 or TA1

# Order

Examp

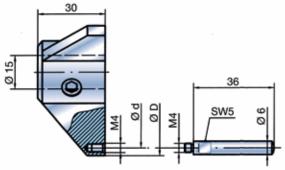

M24 x 1 threading (for screw connection to IA15-C 15-F, for example).	M4 0 M
r suffix: M24 nple: TA15-A-45-SO-Ø d = 32-M24	

ØD	Ød	Order Code	ØD	Ød	Order Code
45	38	TA15-A-45	160	153	TA15-A-160
75	68	TA15-A-75	220	213	TA15-A-220
110	103	TA15-A-110	260	253	TA15-A-260



# TA15-C

#### **Basic depth stop body**

Can be attached to TV15 or MH10.

To be screwed onto special stop rings or TA15/TA15-A with M24 x 1 threading. Special stop rings can be produced on request.

Order Code TA15-C

# TA-KW

#### Depth stop designed for clamping to **BMD** guide cylinders

Available versions:

- TA-KW depth stop, steel, non-hardened (standard)
- TA-KH depth stop, steel with 3 carbide (HM) balls as contact points in pitch diameter TK
- TA-KG depth stop, steel, hardened
- (Caution: increased risk of distorsion of BMD cylinder)

TA-KW depth stops can only be produced up to 100 mm! Sample order: TA-KW-15.75 (= Ø d)

Ød	ØD	ΤК	h	G	Ød	ØD	ΤК	h	G
3-5	27	16	10	M4	35-40	65	53	12	M5
5-8	30	19	10	M4	40-45	70	58	12	M5
8-11	33	22	10	M4	45-50	75	63	12	M5
11-15	37	26	10	M4	50-60	85	73	12	M5
15-20	42	31	10	M4	60-70	95	83	12	M5
20-25	50	38	12	M5	70-80	105	93	12	M5
25-30	55	43	12	M5	80-90	115	103	12	M5
30-35	60	48	12	M5	90-100	125	113	12	M5

# TA15-F **TA8-F**

#### Spring-loaded depth stop

Can be attached to TV15 or TV8. Spring stroke is continuously adjustable from 0 to 7 mm. TA15-F can be combined with TA15-M24, TA15-A-M24 and special depth stop disks. TA8-F always has to be used in combination with special depth stop disks. Sample application: For measuring short bores on two measuring planes (taper, etc.)

Order Code TA15-F (to be clamped on TV15) TA8-F (to be clamped on TV8)

ØD	Ø D1	G1
30	35	M24x1
20	26	M18x1

# Sample application

For measuring short bores on two measuring planes (taper, etc.).


The TA15-F (1) with special depth stop ring (2) is attached to a depth extension (3).

The workpiece (4) is pulled over the BMD to the stop point.

After first measurement, the workpiece is pressed to the end of spring stroke, and a second measurement is taken.

This unit can also be configured as a measuring station (1 42). Special depth stop rings available on request.



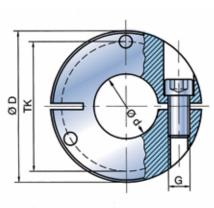


SW4 (M5)


M24 x

30

28 Ö

 $\odot$ 

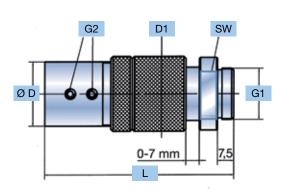

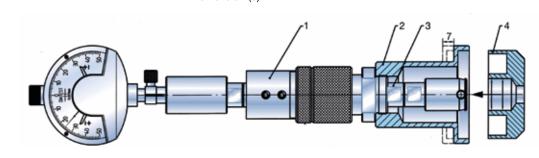


41

unit can be installed. Applications: direct measurement at production machines, honing machines, grinding machines, etc. Can be combined with standard components of BMD Series 6 and 10. Series 4 BMD must be adapted accordingly. A wide range of adjustment options ensures optimum handling. Special models with longer midsections (for large BMD plug gauges) or longer side components are available on request. Clamping brackets used to mount the KM (e.g. on a workbench) are

KM

These fixtures are used for stationary measurements of smaller

workpieces. One or more BMD

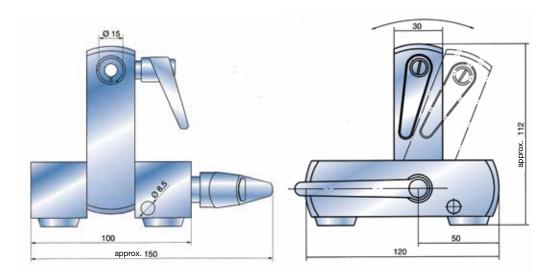


# 

KM-MH

# Indicator holder

Can be clamped directly into the KM. Without plastic grip.

Order Code KM-MH

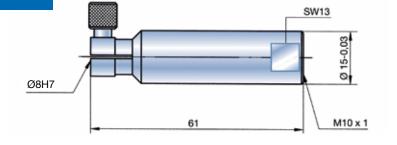


# KM-GK

#### Slotted clamping sleeve

For clamping TV8 depth extensions into the KM.

Order Code KM-GK




# KM-KB

#### **Clamping bracket**

For mounting the small measurement fixture (e.g. on a workbench). The Ø 8 bolt is inserted into the Ø 8.5 bore in the KM.

Not included with the KM.

Order Code KM-KB

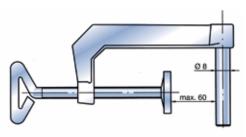



#### Adjustable clamping lever

For TA15 depth stops. Facilitates rapid depth stop adjustment.

Order Code KM-VK









BMD

KM

TA15-A

KM-GK1

0

KM

KM-MH

TV15

KM

TV8

MTD

MH10-61

MH6-51

Ş.

The KM-GK slotted clamping sleeve is always used as an adapter when clamping a TV8.

Sample applications An EH can also be used instead of a KM-MH for an inductive probe (29). In this case, an additional TV15 is required and

clamped into the KM.


Several KM fixtures can be combined.


Fixtures with different dimensions X (min. 30 mm) or more measurement points than the KM6 as well as individual components required to upgrade existing small measurement fixtures are available on request.

estell-Nr.	Х
KM1	0
KM2	80
KM3	80-80
KM4	80-80-80
KM5	80-80-80-80
KM6	80-80-80-80-80

DIATES

The W6 right-angle attachment and matching holder are required for use with BMD series 6 and a TV8.

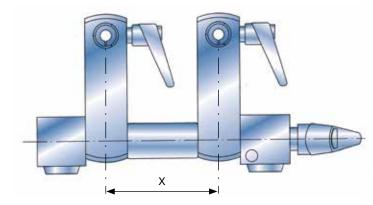

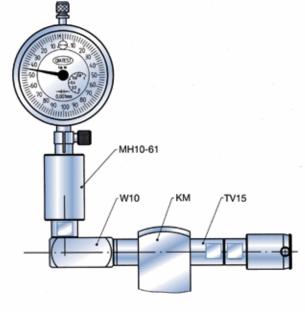


#### Small measuring fixtures for multiplane plugs

The holder for EH-M40 x 1.5 multiplane plugs can be clamped directly into the KM-ME.

The EH-M35 x 1.5 holder can only be clamped with the aid of a KM-ME35-40 clamping sleeve.


Special versions with longer midsections (for large BMD diameters) or longer side elements are available on request. Clamping brackets for use in mounting the KM (e.g. to a workbench), see 1 42. Not included in the delivery package.

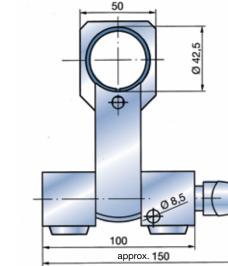


Several KM-ME fixtures can be combined.

Order Code	X
KM-MF1	0
KM-ME2	80
KM-ME3	80-80
KM-ME4	80-80-80
KM-ME5	80-80-80-80
KM-ME6	80-80-80-80-80

Fixtures with different dimensions X (min. 30 mm) or more measurement points than the KM-ME6 as well as individual components required to upgrade existing small measurement fixtures are available on request.

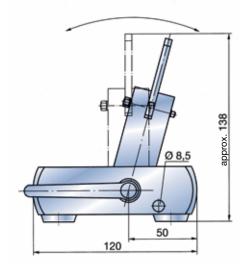


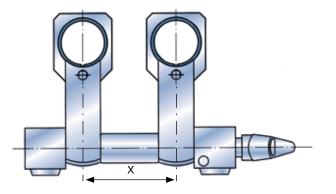


# KM-ME35-40

#### **Slotted clamping sleeve**

Required for clamping the EH-M35 x 1.5 holder into the KM-ME. Order Code KM-ME35-40

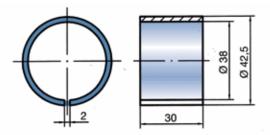

#### **Sample application**

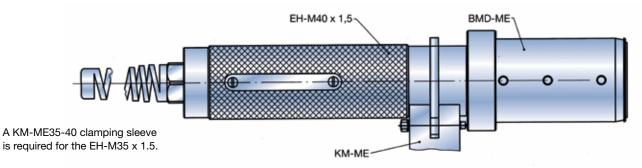



Diatest delivers measuring fixtures on customers request based on our product range.

#### Examples

#### Fixture 1

Measuring table with space for setting master and BMD for internal and external measurement

#### Fixture 2


Measuring table with dial indicator holder for flatness inspection

#### **Fixture 3**

Measuring table with extension and BMD for internal and external measurement

#### Fixture 4


Measuring table for checking of parallel distances on 2, 4 or 6 points

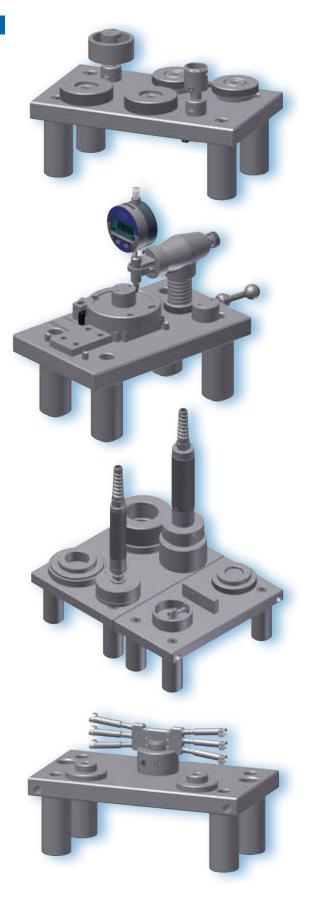

Ċ



Floating holders (2) are used in combination with BMD type PK with pilot taper (3) for measurements in fixtures. The purpose of the floating holder is to compensate for positioning errors from BMD to bore and to bridge minor angular errors from BMD to bore axis. Floating holders are mounted in clamping sleeves with diameters of 20, 30 and 50 mm. They should not be clamped to tightly in order to ensure the function of the float holder. Floating holders SH-BMD20 and SH-BMD30 do not have anti-twist protection. When using an inductive probe, a probe spacer ring is required (MUZ10). It may be necessary to remove the protective bellows in the inductive probe. Option AT0 is recommended for applications involving frequent BMD changes (see **1**8), especially for indicator units with inductive probes (1).

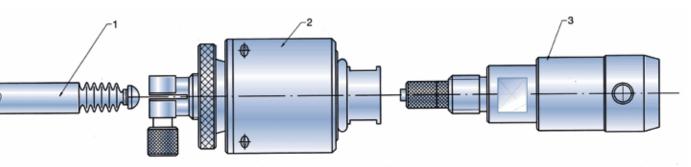


#### SH-BMD20

#### Floating holder with 20 mm outside diameter

Order Code SH-BMD20-6

Technical data

Adjusting nut (A)	Float range	Axial tilt angle<	
0 revolutions	±0 mm	0°	
1 revolutions	± 0.13 mm	2° 40'	Ø8
2 revolutions	± 0.26 mm	3°	
3 revolutions	± 0.39 mm	3° 20'	
4 revolutions	± 0.5 mm	3° 35'	

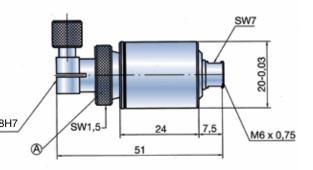


# SH-BMD30

#### Floating holder with 30 mm outside diameter

Order Code SH-BMD30-6 (connection thread M6 x 0,75) SH-BMD30-10 (connection thread M10 x 1)

Technical data

Adjusting nut (A)	Float range	Axial tilt angle<
0 revolutions	±0 mm	0°
1 revolutions	± 0.125 mm	0° 30'
2 revolutions	± 0.25 mm	0° 50'
3 revolutions	± 0.375 mm	1°
4 revolutions	± 0.5 mm	1° 5'
5 revolutions	± 0.625 mm	1º 10'
6 revolutions	± 0.75 mm	1° 10'

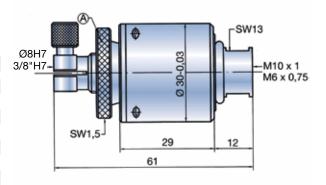

#### Setting the float range for SH-BMD20+30


Set the adjusting nut (A) to float range 0, but do not tighten, as otherwise the holder will be pulled backwards along with the BMD and will no longer float in parallel!

Then set the desired float range and tighten the adjusting nut with an Allan wrench. When using small-diameter BMD, it is especially important to ensure that the float range is not set too high. An excessively large float range can cause collision of the front face of the BMD.



#### SH-BMD50

Floating holder with anti-impact protection

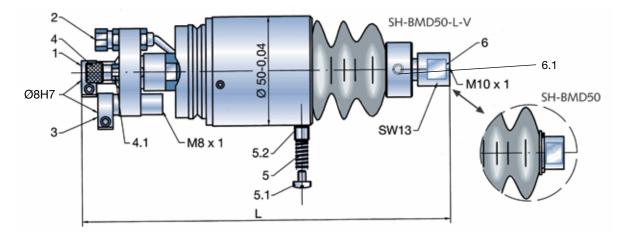

Floating holders with anti-impact protection are generally used in fully automatic measuring systems. The floating holder is secured against twisting.

#### **Models**

SH-BMD50	Without air supply or
	fine adjustment L = 150
SH-BMD50-V	Without air supply, with
	fine adjustment L = $165 \pm 1,5$
SH-BMD50-L-V	With air supply and
	fine adjustment $L = 165+1.5$

#### Applications

BMD up to nom. diameter of 150 mm with horizontal installation, BMD up to nom. diameter of 250 mm with vertical installation, BMD with Option L (with air outlet at the gauging contacts)

#### Fine adjustment (Type V)

If the BMD is changed frequently, the probe can be calibrated to the electronic zero point on the fine adjustment unit without shifting the position of the probe itself.

#### Anti-impact protection

with 22 mm recoil stroke

Sample applications:

- Bore missing, workpiece incorrectly positioned, etc. The SH-BMD with proximity switch stops the machine if recoil is too great.
- BMD moves to the bottom or step of a blind or stepped bore. The bore depth is measured additionally via the recoil stroke of the SH-BMD50 and an electronic probe.
- BMD-SO-KO (see 118) is inserted into the bore to the depth stop point.

#### **Technical description**

- 1 Collet bore Ø 8H6 with tangential clamp for mounting the probe.
- 2 Compressed air hose (c. 3-4 bar) only for version "L"
- 3 Collet bore Ø 8H6 for proximity switch with M8 x 1 threading in the front section
- 4 Set screw for float range.
  1 revolution = ±0.25 mm float range
- 4.1 SW7 lock nut to secure set screw.
   For float range = 0: Tighten nut against the set screw, tighten adjusting screw completely.
- 5 Weight balance spring with variable spring pressure of 4-30 N
- 5.1 Set screw for weight balancing
- 5.2 Spring sleeve
- Type V: The fine adjustment fixture can be adjusted by ±1.5 mm by loosening the clamping screw SW3 (6.1). It is no longer necessary to move the probe for change of BMD.

#### Setting the float range

Tighten nut 4.1 slightly against the head of set screw 4. Tighten screw 4 to the stop point (= float range 0). Turn back screw 4 (1 revolution =  $\pm 0.25$  mm float range) until the desired float range is set. Tighten screw 4 against nut 4.1 to secure the screw against turning. The maximum float range is  $\pm 0.75$  mm.


#### Weight compensation

In horizontal applications, the BMD is balanced in the center position by adjusting set screw 5.1 or replacing spring 5. This prevents excessive wear on the pilot taper when the plug is inserted into the bore. The delivery package includes 2 springs with different strengths. Spring 5 must be removed in vertical configurations.

# SH-BMD50-10


#### **Protective sleeve for SH-BMD50**

This sleeve protects the fitted electronic probe and proximity switch. three pinch screwings (for electronic probe, proximity switch and air hose) ensure all cables have strain relief and provide splash-proof protection.

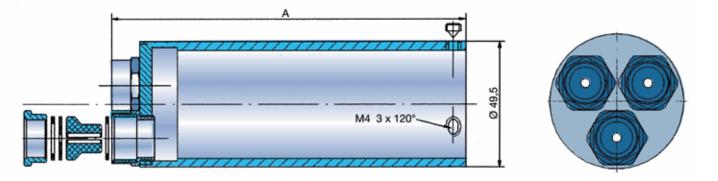

#### **Sizes**

Length A	Order Code
152 mm	SH-BMD50-10
190 mm	SH-BMD50-10-190

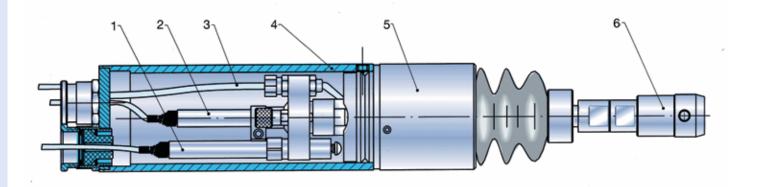

#### **Example**


- 1 Proximity switch or probe
- 2 Electr. probe
- 3 Air hose
- 4 Protective sleeve
- 5 Floating holder
- 6 BMD-PK

5.



SH-BMD-ME

Floating holder for multiplane plug gauges

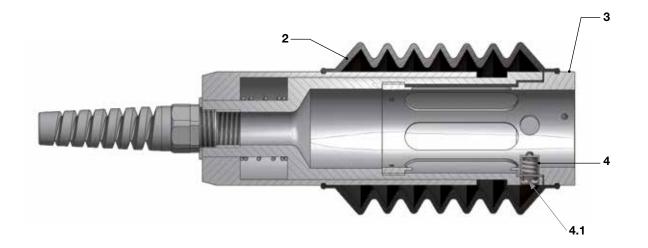

The floating holder for multiplane plug gauges with anti-impact protection is designed exclusively for use with type ME-BMD (f) 22).

#### Please note:

Connection type 5, size 2 (see  $\blacksquare$  22) is required for installation of a multiplane BMD.


#### Weight compensation

For horizontal applications, the BMD is balanced in an approximate central position by adjusting the two set screws 4.1 or by replacing the two springs 4. The 2 set screws are positioned at an angle of 96° and must be aligned during installation in such a way that they point downward and are offset by c. 48° to the vertical axis.

#### **Technical description**

- 1 M8 x 1 threaded bore for proximity switch (antiimpact protection). Spring stroke approx. 20 mm
- 2 Protective bellows to protect against splashing

- 3 Spring cage allows free floating. Float range approx. ±1 mm; non-adjustable.
- 4 Weight compensation spring for horizontal applications. Total of two spring sets at an angle of 96°. The springs must be positioned during installation in the machine or fixture in such a wat that weight compensation can be achieved. The springs must be removed for vertical installation of the SH-BMD-ME.
- 5 Anti-twist protection. The floating holder is protected against twisting.
- 3 mounting screws for multiplane BMD
   (3 x 120°). A type 5 connection on the BMD is required for plug gauge installation.
- 7 Probe with Ø 8h6 extension diameter (and air hose, if applicable). The cable and hose are drawn out of the floating holder through the anti-bend protector.
- 8 Type 5, size 2 connection (on BMD)
- 9 Multiplane BMD
- 10 Pilot taper

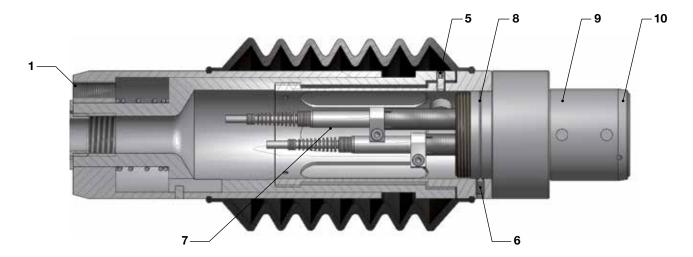

#### Some BMD

HM-T


Ε

components are replaceable. However, it is essential to ensure that the correct parts are used. Use of the wrong parts will result in incorrect measurements.

#### Part codes:

F


- HM-T Carbide pressure needle
- F Spring (not for Series 4) FH
  - Spring sleeve



### **Carbide pressure needles**

Pressure needles can be replaced separately. It is important to ensure that the correct pressure needles are used. Pressure needles are marked with notches.

no notch	2-point BMD, BMD-FB6
2 notches	BMD-FB10
3 notches	3-point BMD
more than 3 notches	Special-purpose pressure needle

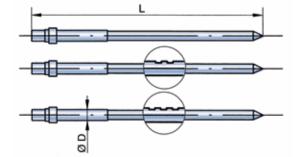

Description	Series 4 (M3,5 x 0,35)			Series 6 (M6 x 0,75)			,75)		Series	s 10 (M10	x 1)	
НМ-Т	ØD	L	Notches	Order Code	ØD	L	Notches	Order Code	ØD	L	Notches	Order Code
2-point	1.5	42.8	0	HM-T4	1.5	42.8	0	HM-T6	2.7	59.5	0	HM-T10
FB					1.5	42.8	0	HM-T6	2.7	59.5	2	HM-T10-FB
3-point					1.5	42.5	3	HM-T6-3P	2.7	58.5	3	HM-T10-3P
spring					2.5	4		F6	3.7	10		F10
spring sleeve	2.8	6		FH4	4.5	5		FH6	7	8.5		FH10

# **ZU** Accessories: Setting rings according to DIN 2250-C and DIATEST company standard

Setting rings are used to calibrate the measuring device. Setting rings to DIN 2250-C standard are suited best for this

purpose. They are available in all intermediate sizes from Ø 1 mm to 315 mm.

Settings rings to DIATEST company (from Ø 3,0 to 40,0 mm). standard may also be used. However, these rings are only available in fixed diameters

Setting rings DIN 2250-C, tolerance table

#### Setting rings DIN 2250-C, tolerance table

	_							
Version		Nominal-Sizes				Dimensions		
mm			d <sub>1</sub>		b <sub>1</sub>	d <sub>2</sub>	d <sub>3</sub>	
	>	1	-	2,5	4	22		
	>	2.5	5 -	3	5	22		
	>	3	-	5	5	22		
	>	5	-	6	8	32		
	>	6	-	10	8	32		
	>	10	-	15	10	38		
	>	15	-	18	12	45		
	>	18	-	20	12	45		
	>	20	-	25	14	53		
	>	25	-	30	16	63		
	>	30	-	32	16	63		
	>	32	-	40	18	71		
	>	40	-	50	20	85		
	>	50	-	60	20	100		
	>	60	-	70	24	112		
b1	>	70	-	80	24	125		
	>	80	-	90	24	140		
	>	90	-	100	24	160		

	I	mm		
		- d3	d2	_
b1				


Version

Nominal-Sizes		Dim	ensior	าร
d <sub>1</sub>	b <sub>1</sub>	b <sub>2</sub>	d <sub>2</sub>	d <sub>3</sub>
> 100 - 110	28	14	170	132
> 110 - 120	28	16	180	140
> 120 - 130	28	16	190	150
> 130 - 140	28	18	200	160
> 140 - 150	28	18	212	170
> 150 - 160	28	20	224	180
> 160 - 170	32	20	236	190
> 170 - 180	32	20	250	200
> 180 - 190	32	22	265	212
> 190 - 200	32	22	280	224
> 200 - 212	32	22	300	236
> 212 - 224	32	25	315	250
> 224 - 236	36	25	335	265
> 236 - 250	36	28	355	280
> 250 - 265	36	28	375	300
> 265 - 280	36	28	400	315
> 280 - 300	36	32	425	335
> 300 - 315	36	32	450	355

Also available in inch sizes

# Setting rings - DIATEST company standard

<b>-</b>								
Nom. diameter	Outside	Height H	Nom. diameter	Outside	Height H			
Ø N mm	Ø A mm	mm	Ø N mm	Ø A mm	mm			
R - 2.000	20.0	4.5	R - 16.000	36.0	7.5			
R - 2.250	20.0	4.5	R - 16.500	36.0	7.5			
R - 2.500	20.0	4.5	R - 17.000	36.0	7.5			
R - 2.750	20.0	4.5	R - 18.000	36.0	7.5			
R - 3.000	20.0	4.5	R - 19.000	36.0	7.5			
R - 3.250	20.0	4.5	R - 20.000	36.0	7.5			
R - 3.500	20.0	4.5	R - 21.000	45.0	10.0			
R - 3.750	20.0	4.5	R - 21.500	45.0	10.0			
R - 4.000	20.0	4.5	R - 22.000	45.0	10.0			
R - 4.500	20.0	4.5	R - 23.000	45.0	10.0			
R - 5.000	20.0	4.5	R - 24.000	45.0	10.0			
R - 5.500	20.0	4.5	R - 25.000	45.0	10.0			
R - 5.750	20.0	4.5	R - 25.500	45.0	10.0			
R - 6.000	20.0	4.5	R - 26.500	45.0	10.0			
R - 6.500	20.0	4.5	R - 27.000	45.0	10.0			
R - 7.000	20.0	4.5	R - 28.000	45.0	10.0			
R - 7.500	20.0	4.5	R - 29.000	45.0	10.0			
R - 7.750	20.0	4.5	R - 30.000	45.0	10.0			
R - 8.000	20.0	4.5	R - 31.000	60.0	12.0			
R - 8.500	20.0	4.5	R - 32.000	60.0	12.0			
R - 9.000	20.0	4.5	R - 33.000	60.0	12.0			
R - 9.500	20.0	4.5	R - 34.000	60.0	12.0			
R - 10.000	36.0	7.5	R - 35.000	60.0	12.0			
R - 11.000 R - 11.500	36.0 36.0	7.5 7.5	R - 36.000	60.0	12.0			
R - 11.500 R - 12.000	36.0	7.5 7.5	R - 37.000	60.0	12.0			
R - 12.000 R - 13.000	36.0	7.5 7.5	R - 38.000	60.0	12.0			
R - 13.000 R - 14.000	36.0	7.5	R - 39.000	60.0	12.0			
R - 14.000 R - 15.000	36.0	7.5	R - 40.000	60.0	12.0			
n - 15.000	30.0	7.5	11 - 40.000	00.0	12.0			

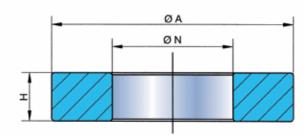

#### Accuracy of DIATEST setting rings (company standard)

Max. deviation from nom. diameter:	0.0009 mm
Max. concentricity error:	0.0003 mm
Max. rough dept:	0.00002 mm
Hardness:	62-64 HRC

Order Code = R-nom. diameter Sample order: R-25.500

Also available:

- DIATEST-Setting rings
- with Ø 10.5 / 11.5 / 12.5 ... to 29.5
- Also available in fixed inch sizes

	Page 🗊
A	- Adapter 34-35
AD	- Cover 7
AH	- Holder for Analodig indicator 33
AT0	- Toleranced connecting length 8
BL	- Holder with marking strip 26
BLE	- Replacement marking strip 26
BM	- Inspection plug 8
BMD	- Plug gauge 10-23
D	- Basic BMD type for through
	bores 11
D	- Order suffix for rotary
	adapter/holder 32, 38
EH, EHT	- Holder for electronic
	probes 29, 31
F	<ul> <li>Order suffix for depth</li> </ul>
	extension with spring 30, 50
FB	- Basic type for blind bores 12
GK	- Slotted clamping sleeve 42
НМ	- Carbide 42-44
НМ-Т	- Carbide pressure
	needle 13, 30, 47
KB	- Clamping bracket 6
KM	- Small measurement fixtures 50
L	- BMD or accessories
	with air supply 42-44
MB-B	- Measurement range limitation 6 - Measurement range extension 5
MB-SO MCR	- Measurement range extension 5 - Hard chrome contact points 6
MDI	- Diamond contact points 7
ME	- Multiplane plug gauges 22-23
MH	- Indicator holders 24-28
мнм	- carbide contact points 6
MKE	- ceramic contact points 6
MKK	- Plastic gauging contacts 7


	Page 🗊		
MR	- Gauging radius 6		
MRU	- ruby contact points 7		
MZ	- Reduced cylinder diameter		
	tolerance 8		
M24	- Depth stop with M24		
	threading 40, 41		
NHM	- Pressure needle for		
	BMD-PA-6 21		
NFB	- Pressure needle f. BMD-PA-6 21		
NT-HM	- Pressure needle f. BMD-PA-4 21		
NT-FB	- Pressure needle for		
	BMD-PA-4-FB 21		
OCR	<ul> <li>BMD with steel cylinder</li> </ul>		
	(not chrome coated) 4		
OD	- BMD for outside diameter 20		
OR	- BMD without pilot taper 15		
PA	- BMD gauge for parallel wall		
	gauging 21		
PG	<ul> <li>BMD without inherent</li> </ul>		
	measurement pressure 8		
PK	- BMD with pilot taper 9, 14		
R	- Gauging radius (dimension) 6		
	- Setting ring 50		
S	- Basic type standard BMD 10		
S-FB	- BMD, Type S		
	with shortened L1 15		
SH-BMD	<ul> <li>Floating holder for</li> </ul>		
	BMD PK 46-49		
SO	- Special-purpose design 15-20		
SO-B	- Special marking 4		
SO-DZL	- BMD with extended L1 17		
	- BMD for stepped bores 18		
SO-GL	- BMD for longitudinal		
	groove measurement 18		

	Pa	age 🗊
SO-KO	- BMD for tapered inside	
	diameters	18
SO-KW	- BMD for crankshaft	
	bearing width	19
SO-PA	- BMD for parallel wall	
	measurement	19
SO-SZ	- BMD with special cylinder	19
SO-ZL	- BMD with extended L1	
	and/or L2	17
SO-TA	- BMD with built-in depth stop	) 16
SO-W	- Right-angle attachment and	
	BMD plug gauge; short forn	n 36
SO-2Z	- BMD with 2 guide cylinders	18
TA	- Depth stops	10, 41
T-BMD	- BMD for small diameters	17
тν	<ul> <li>Depth extension with</li> </ul>	
		87, 38
тит	<ul> <li>Depth extension without</li> </ul>	
		37, 38
UM	- BMD with reduced	
	entry diameter	15
V	- Holder or floating holder wit	
	fine adjustment 102, 3	
VK	- Adjustable clamping lever	42
W	- Right-angle attachment	36
Z	- Order Code for 3/8" special	
		24-33
ZHML	- BMD with carbide bars	14
ZKUL	- BMD with plastic bars	17
2R	- BMD with 2 guide grooves	16
S0-2Z	- BMD with 2 cylinders	18
3P	- BMD in 3-point	0 16
	configuration	9, 16



Ċ



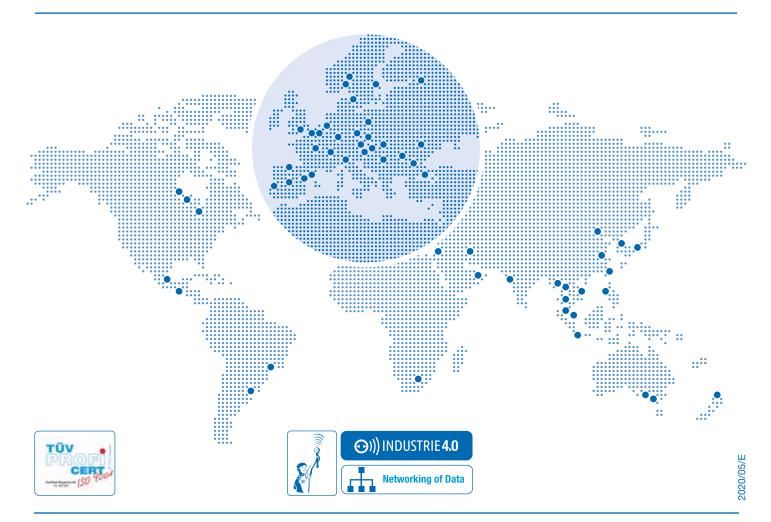

#### Brazil

#### **DIATEST do BRASIL**

Produtos de Medição LTDA R. Ulisses Cruz, nº 1052 -3º.andar - CJ.06 - Tatuapé ZIP: 03077-000 - São Paulo -SP - Brazil C. +55 1120918811 ☑ info@diatest.com.br www.diatest.com.br

#### Sweden

#### **DIATEST Sverige**

**AB Hans Ehlers** Ranhammarsvägen 24 168 67 Bromma Sweden +46 856470188 ٤. +46 8362279 ☑ info@diatest.se www.diatest.se

# Germany

# DIATEST

Hermann Költgen GmbH Schottener Weg 6 D-64289 Darmstadt Germany t.

+49 61519790 +49 6151979111 ☑ info@diatest.com www.diatest.com

USA

e.

**DIATEST USA** 

1188 Heather Drive

Lake Zurich, IL 60047

+1 1800-DIATEST

847-550-4024

☑ info@diatestusa.com

847-847-1947

www.diatest.us

#### France

#### **DIATEST COME Metrologie**

145, Avenue du Stade 42170 St. Just St. Rambert France

+33 477550139 info@diatest-come.fr www.diatest-come.fr

**United Kingdom** 

DIATEST (U.K.) Ltd.

18, Avondale Avenue,

KT10 0DA

England

٤.

Hinchley Wood, Surrey,

+44 2083981100

+44 2083989887

Sales@diatest.co.uk

www.diatest.co.uk

#### Japan

#### **DIATEST JAPAN Ltd.**

15-29, 1-Chome Hitotsuya 580-0003 Matsubara City, Osaka Japan +81 723306661 +81 723338223 🖂 d-info@diatest-j.co.jp www.diatest-j.co.jp

# People's Republic of China

#### **DIATEST Measuring**

Instruments (Beijing) Co., Ltd. Room 602, Ocean Business Center No. 61 Balizhuang Xili, **Chaoyang District** 100025 Beijing +86 1085865481

- ٤. +86 13701161985
- +86 1085865483
- ☑ china@diatest.com.cn
- www.diatest.cn

Copyright 2020 © DIATEST Hermann Költgen GmbH Errors and omissions excepted. Technical modifications possible subject to state-of-the-art-technology. )))) = wireless